



HOME CARE & WARRANTY GUIDE

PWC





DEAR DAVID BERNARD HOME PURCHASER:

CONGRATULATIONS AND THANK YOU FOR PURCHASING A HOME FROM DAVID BERNARD BUILDERS & DEVELOPERS (DAVID BERNARD). WE PRIDE OURSELVES IN OUR COMMITMENT TO PROVIDE QUALITY THAT IS SUPPORTED BY A COMPLETE SERVICE AND WARRANTY PROGRAM. CUSTOMER CARE AT DAVID BERNARD MEANS SETTING STANDARDS OF PERFORMANCE AND EXPECTATION FOR YOU AND THEN MEETING THOSE COMPANY STANDARDS.

WE HOPE BY SUPPLYING YOU WITH THE FOLLOWING INFORMATION IN ADVANCE THAT THIS WILL HELP YOU UNDERSTAND WHAT TO EXPECT FROM DAVID BERNARD IN THE AREAS OF SERVICE AND WARRANTY IN THE FUTURE.

SINCE OUR HOMES ARE INDIVIDUALLY CONSTRUCTED, AND NO TWO HOMES ARE EXACTLY ALIKE, DAVID BERNARD HAS ESTABLISHED PERFORMANCE STANDARDS THAT EACH HOUSE IS REQUIRED TO MEET. ANYTHING THAT FALLS BELOW OUR PERFORMANCE STANDARDS WILL BE CORRECTED TO MEET THEM.

WE HOPE BY PROVIDING YOU WITH THIS INFORMATION, YOU WILL HAVE A CLEAR UNDERSTANDING OF WHAT DAVID BERNARD BUILDERS & DEVELOPERS WILL DO FOR YOU. WE HOPE YOU ENJOY YOUR NEW HOME AND THANK YOU AGAIN FOR PURCHASING A DAVID BERNARD HOME.

SINCERELY,

A handwritten signature in black ink, appearing to read 'Todd M. Stutz'. The signature is stylized and written over the printed name and title below it.

TODD M. STUTZ
PRESIDENT

TABLE OF CONTENTS

HOW TO OBTAIN SERVICE WARRANTY	PAGE 1
EMERGENCY SERVICES	PAGE 2
DRYWALL REPAIRS	PAGE 2
SERVICE WARRANTY PROCESSING PROCEDURES	PAGE 3
WINTER CONSTRUCTION	PAGE 4
SERVICE WARRANTY COVERAGE	PAGE 5
HOME OWNER'S ASSOCIATION	PAGE 5

THE DAVID BERNARD FIRST YEAR HOME CARE WARRANTY

HOME BUILDER'S LIMITED WARRANTY (PWC FORM NO. 117)

HOW TO OBTAIN SERVICE & WARRANTY

AFTER THE COMPLETION OF YOUR ACCEPTANCE OF CONSTRUCTION LIST, ANY ADDITIONAL REQUESTS WILL BE ADDRESSED THROUGH OUR SERVICE WARRANTY DEPARTMENT. FOR REASONS OF ACCURACY AND TO COMPLY WITH THE TERMS OF YOUR WARRANTY, ALL ITEMS FOR WHICH YOU REQUEST SERVICE NEED TO BE REPORTED IN WRITING. "HOMEOWNER REQUEST FOR SERVICE" FORMS ARE PROVIDED FOR YOUR CONVENIENCE AT THE TIME OF YOUR CUSTOMER ORIENTATION. THESE FORMS CAN BE FOUND AT THE BACK OF THIS SECTION.

WHEN SUBMITTING ITEMS, PLEASE FOLLOW THE STEPS BELOW:

1. PLEASE REFER TO THE DAVID BERNARD BUILDERS AND DEVELOPERS. FIRST YEAR HOME CARE WARRANTY FOUND IN THIS MANUAL AND THE HOME BUILDER'S LIMITED WARRANTY (PWC FORM NO. 117) FOR EACH ITEM IN QUESTION.
 - A.) IS THE REQUESTED ITEM COVERED BY WARRANTY?
 - B.) DOES IT FALL WITHIN THE PERFORMANCE STANDARDS CONTAINED IN THIS MANUAL FOR CONDITIONS OCCURRING DURING THE FIRST YEAR WARRANTY PERIOD?
 - C.) WHO IS RESPONSIBLE FOR THIS ITEM AND WHAT IS THE ACCEPTABLE CORRECTION?
2. PLEASE FILL OUT THE "HOMEOWNER REQUEST FOR SERVICE" FORM. (PLEASE REVIEW THE SAMPLE OF THIS FORM AT THE BACK OF THIS SECTION.)
3. **ALL REQUESTS FOR SERVICE NEED TO BE SUBMITTED IN WRITING TO:**
DAVID BERNARD
3065 CENTRE POINTE DRIVE
ROSEVILLE, MN 55113
ATTN: SERVICE & WARRANTY DEPT.
4. PLEASE PROVIDE ACCESS TO YOUR HOME DURING NORMAL WORKING HOURS 8:00 A.M. TO 5:00 P.M. MONDAY THROUGH FRIDAY.
5. ANY KITCHEN APPLIANCE REQUESTS SHOULD BE HANDLED DIRECTLY WITH THE MANUFACTURERS. THEIR SERVICE PHONE NUMBERS ARE LISTED IN THE USE AND CARE MATERIALS FOR THE INDIVIDUAL APPLIANCES AND ON THE "EMERGENCY SERVICE LABEL" THAT IS PROVIDED TO YOU DURING YOUR CUSTOMER ORIENTATION.

PLEASE BE AWARE THAT ALL SERVICE WARRANTY REQUESTS FOR THE FIRST YEAR HOME CARE WARRANTY MUST BE RECEIVED WITHIN ONE (1) YEAR AFTER CLOSING OR MOVE-IN. THE FIRST YEAR HOME CARE WARRANTY EXPIRES ON THE ONE YEAR ANNIVERSARY DATE OF YOUR CLOSING OR MOVE-IN, WHICHEVER OCCURS FIRST.

EMERGENCY SERVICE

EMERGENCY SERVICE INCLUDES ANY OF THE FOLLOWING SITUATIONS:

- TOTAL LOSS OF HEAT
- TOTAL LOSS OF ELECTRICITY
- PLUMBING LEAK THAT REQUIRES THE ENTIRE WATER SUPPLY TO BE SHUT OFF
- TOTAL LOSS OF HOT WATER
- TOTAL SEWAGE STOPPAGE
- ROOF LEAK
- ANY SITUATION THAT ENDANGERS THE OCCUPANTS OF THE HOME

PLEASE CALL THE NECESSARY SUBCONTRACTOR DIRECTLY. 24 HOUR EMERGENCY NUMBERS ARE LOCATED IN THE FOLLOWING AREAS:

EMERGENCY #	LOCATION
PLUMBING	ON WATER HEATER
HEATING & AIR CONDITIONING	ON FURNACE
ELECTRIC	ON CIRCUIT BREAKER BOX

THEIR PHONE NUMBERS ARE ALSO LISTED ON THE “**EMERGENCY SERVICE LABEL**” THAT IS PROVIDED TO YOU DURING YOUR CUSTOMER ORIENTATION.

PLEASE CONTACT THE SERVICE WARRANTY DEPARTMENT IF ANY COSMETIC OR STRUCTURAL DAMAGE HAS ALSO OCCURRED AS A RESULT OF THIS EMERGENCY.

DRYWALL REPAIRS

DRYWALL REPAIRS WILL BE COMPLETED IN YOUR HOME, **ONE TIME ONLY**. TO ALLOW THE HOME TO STABILIZE ITSELF, IT IS RECOMMENDED THAT DRYWALL REPAIRS ARE CORRECTED AT THE END OF THE FIRST YEAR HOME CARE WARRANTY PERIOD, USUALLY DURING THE **ELEVENTH MONTH**. PLEASE BE AWARE THAT THE BUILDER WILL REFINISH OR REPAINT THE REPAIRED AREA ONLY. WHEN YOU ARE READY TO HAVE YOUR DRYWALL REPAIRED, PLEASE FOLLOW THE STEPS BELOW.

- PLEASE REFERENCE THE DAVID BERNARD FIRST YEAR HOME CARE WARRANTY PERFORMANCE STANDARD REGARDING ANY DRYWALL ITEMS IN QUESTION.
- PLEASE MAKE A SEPARATE DRYWALL LIST USING THE ATTACHED FORM FOUND AT THE BACK OF THIS SECTION.
- PLEASE BE SPECIFIC IN YOUR DESCRIPTION OF THE AREA TO BE CORRECTED. A COPY OF YOUR REQUEST WILL BE ISSUED TO THE SUBCONTRACTOR. HE/SHE WILL CORRECT ONLY THOSE ITEMS LISTED ON THE REQUEST FORM.
- IF YOU HAVE CHANGED THE WALL PAINT COLOR, WE WILL ONLY DO THE REPAIR, NOT THE PAINTING.

(Continued)

- **AN ITEM TO NOTE REGARDING WALLPAPER AREAS:** IF REQUESTED, SHEETROCK REPAIRS WILL BE COMPLETED IN WALLPAPERED AREAS. THE WARRANTY DOES NOT COVER REPAIR OR REPLACEMENT OF THE WALLPAPER. YOU MAY WANT TO CONSIDER WAITING UNTIL AFTER THE FIRST YEAR TO WALLPAPER YOUR HOME.
- PLEASE PROVIDE ACCESS TO YOUR HOME DURING NORMAL WORKING HOURS, 8:00 A.M. TO 5:00 P.M. MONDAY THROUGH FRIDAY.
- PLEASE SUBMIT YOUR DRYWALL LIST BY MAIL TO:
DAVID BERNARD
3065 CENTRE POINTE DRIVE
ROSEVILLE, MN 55113
ATTN: SERVICE & WARRANTY DEPT.

SERVICE WARRANTY PROCESSING PROCEDURES

UPON RECEIPT OF ANY “HOMEOWNER REQUEST FOR SERVICE” FORM OR LETTER, IF NEEDED, THE SERVICE WARRANTY DEPARTMENT WILL CONTACT YOU FOR AN INSPECTION APPOINTMENT.

- APPOINTMENTS ARE AVAILABLE MONDAY THROUGH FRIDAY, 8:00 A.M. TO 5:00 P.M.
- THE ITEMS LISTED IN YOUR WRITTEN REQUEST WILL BE INSPECTED TO DETERMINE APPROPRIATE ACTION.
- A WRITTEN SERVICE WORK ORDER WILL BE ISSUED, NOTIFYING OUR SUBCONTRACTOR AND AUTHORIZING REPAIRS FOR YOUR HOME. IT IS THE RESPONSIBILITY OF THE SUBCONTRACTOR WHO RECEIVES THE WORK ORDER TO CONTACT YOU FOR AN APPOINTMENT. IF YOU ARE DIFFICULT TO REACH BY TELEPHONE, YOU ARE WELCOME TO EXPEDITE THIS PROCESS BY INITIATING THE CALL TO OUR WARRANTY SERVICE DEPARTMENT. APPOINTMENTS FOR REPAIR WORK ARE AVAILABLE MONDAY THROUGH FRIDAY, 8:00 A.M. TO 5:00 P.M.
- COMPLETION OF SERVICE WARRANTY ITEMS CAN BE EXPECTED WITHIN **FIFTEEN (15) WORKING DAYS** OF THE SERVICE WORK ORDER ISSUE DATE UNLESS YOU ARE OTHERWISE NOTIFIED.

WINTER CONSTRUCTION

■ ESCROW ITEMS

DURING THE WINTER MONTHS, WE MAY NOT BE ABLE TO COMPLETE SOME OF THE EXTERIOR ITEMS ON YOUR BUILDING. THESE ITEMS MAY INCLUDE ASPHALT WORK, FINAL GRADING, CONCRETE WORK, GARAGE FLOORS, STOOPS, SIDEWALKS, ETC. AT THE TIME OF YOUR CLOSING, MONEY FOR THESE ITEMS (1 1/2 TIMES THE VALUE) WILL BE PUT INTO AN ESCROW ACCOUNT. THIS WORK WILL BE COMPLETED WHEN WEATHER AND SOIL CONDITIONS PERMIT. DUE TO ROAD, WEIGHT RESTRICTIONS IMPOSED BY THE STATE, COUNTY OR CITY IN THE SPRING, THIS WORK TYPICALLY CANNOT START UNTIL AFTER MAY 15TH.

OUR PROJECT SUPERINTENDENTS AND SUBCONTRACTORS WILL BE RESPONSIBLE FOR DETERMINING WHEN THE WORK CAN BE COMPLETED. PLEASE BE AWARE THAT DURING THIS TRANSITION FROM WINTER TO SPRING, THERE MAY BE A PERIOD OF TIME WHERE YOUR TEMPORARY PRIVATE STREETS MAY BECOME IMPASSABLE DUE TO THE SOIL CONDITIONS. WE ASK YOU TO PLEASE BE PATIENT AND YOU WILL NEED TO PARK IN THE STREET UNTIL YOUR DRIVEWAY DRIES OUT.

OUR PROCESS OF COMPLETING CONCRETE AND ASPHALT WORK IS ACCOMPLISHED BY STARTING IN ONE AREA. WE ASK YOU TO PLEASE BE PATIENT WITH THIS PROCESS. IF YOU DO HAVE ANY QUESTIONS REGARDING THE COMPLETION OF ESCROW ITEMS, YOU MAY CONTACT OUR PROJECT SUPERINTENDENT IN THEIR SITE TRAILER.

■ TEMPORARY PROPANE

IF YOUR HOME IS BEING COMPLETED DURING THE WINTER MONTHS IT IS NECESSARY TO INSTALL PROPANE TEMPORARILY UNTIL THE NATURAL GAS LINE TO YOUR HOUSE CAN BE INSTALLED. PLEASE BE AWARE THAT ON OR NEAR YOUR DAY OF CLOSING, WE WILL TAKE A READING OF THE PROPANE GAS METER. WE WILL NOTIFY THE GAS COMPANY OF THE AMOUNT OF PROPANE LEFT IN THE TANK AND ALSO GIVE THEM YOUR NAME AND ADDRESS.

SHORTLY AFTER YOU MOVE INTO YOUR HOME, YOU WILL RECEIVE A LEASE AGREEMENT FOR THE TEMPORARY TANK FROM THE PROPANE GAS COMPANY. THE LEASE MAY SHOW CHARGES FOR THE TANK; HOWEVER, YOU MAY DISREGARD THESE CHARGES BECAUSE THEY HAVE BEEN PREPAID BY DAVID BERNARD THEREFORE, FOR YOUR OWN PROTECTION, PLEASE PROMPTLY RETURN THE LEASE AGREEMENT TO THE PROPANE GAS COMPANY. WE APPRECIATE YOUR COOPERATION IN THIS MATTER.

AS SOON AS WEATHER AND SOIL CONDITIONS PERMIT IN THE SPRING, WE WILL TRENCH THE NATURAL GAS LINE TO YOUR HOME.

SERVICE WARRANTY COVERAGE

ALL SERVICE WARRANTY REQUESTS WILL BE BASED UPON OUR FIRST YEAR HOME CARE AND WARRANTY (CONTAINED IN THIS MANUAL) AND THE HOME BUILDER'S LIMITED WARRANTY (PWC FORM NO. 117). PLEASE CAREFULLY READ THIS INFORMATION AS WELL AS OUR SERVICE WARRANTY PROCEDURES. IF YOU HAVE ANY QUESTIONS REGARDING OUR PROCEDURES, PLEASE CONTACT OUR SERVICE WARRANTY DEPARTMENT.

HOME OWNER'S ASSOCIATION

MAINTENANCE OF THE LANDSCAPING AND OTHER EXTERIOR ITEMS IN A TOWNHOME COMMUNITY BECOMES THE RESPONSIBILITY OF THE HOME OWNER'S ASSOCIATION AFTER THE ONE YEAR WARRANTY PERIOD. DURING THE ONE YEAR WARRANTY PERIOD, WARRANTIES FOR THE EXTERIOR ARE PROVIDED BY THE BUILDER.



FIRST YEAR HOME CARE WARRANTY MANUAL

IN ADDITION TO OUR HOME BUILDER'S LIMITED WARRANTY (PWC FORM No. 117), THE ROTTLUND COMPANY, INC. PROVIDES EACH HOMEOWNER WITH A FIRST YEAR HOME CARE WARRANTY. PLEASE REFER TO THE HOME BUILDER'S LIMITED WARRANTY DOCUMENT FOR EXPLANATION OF SPECIFIC RESPONSIBILITY AND COVERAGE. THE HOME BUILDER'S LIMITED WARRANTY REFERS TO OUR PERFORMANCE STANDARDS AND GUIDELINES THAT CONTAIN OUR BUILDING STANDARDS.

ON THE FOLLOWING PAGES OF THIS MANUAL, YOU WILL FIND OUR PERFORMANCE STANDARDS TO PROVIDE YOU WITH AN UNDERSTANDING OF OUR RESPONSIBILITY FOR THE CORRECTION OF CERTAIN CONDITIONS DURING THE FIRST YEAR OF YOUR HOME'S WARRANTY PERIOD. PLEASE NOTE THAT THE PERFORMANCE STANDARDS LISTED HERE ARE APPLICABLE ONLY TO THE FIRST YEAR OF YOUR HOMES WARRANTY PERIOD. UNDER OUR FIRST YEAR HOME CARE WARRANTY, WE WILL UTILIZE THE PERFORMANCE STANDARDS PROVIDED HEREIN TO EVALUATE, AND WHERE APPROPRIATE, REPAIR MINOR PROBLEMS IN YOUR HOME THAT MIGHT NOT RISE TO THE LEVEL OF A CONSTRUCTION DEFECT AS DEFINED IN THE HOME BUILDER'S LIMITED WARRANTY. FOLLOWING THE END OF THE FIRST YEAR OF YOUR HOME'S WARRANTY PERIOD, WE WILL UTILIZE THE OTHER FACTORS CONTAINED IN SECTION III (OUR COVERAGE OBLIGATION) OF THE HOME BUILDER'S LIMITED WARRANTY TO DETERMINE WHETHER A CONSTRUCTION DEFECT EXISTS AT YOUR HOME.

HOW TO USE THIS MANUAL

THIS MANUAL HAS BEEN DIVIDED INTO TWENTY-THREE SECTIONS. PLEASE REFERENCE THE APPROPRIATE SECTION FOR EACH ITEM IN QUESTION. IF THE MANUAL CONTAINS A PERFORMANCE STANDARD THAT INDICATES THAT THE ITEM IN QUESTION IS THE RESPONSIBILITY OF THE BUILDER, PLEASE COMPLETE A “HOMEOWNER’S REQUEST FOR SERVICE FORM” THAT CAN BE FOUND AT THE END OF THIS SECTION. REMEMBER THAT THE PERFORMANCE STANDARDS CONTAINED ON THE FOLLOWING PAGES APPLY ONLY TO THE FIRST YEAR OF THE WARRANTY PERIOD. FOLLOWING THE END OF THE FIRST YEAR OF YOUR HOME’S WARRANTY PERIOD, WE WILL UTILIZE THE OTHER FACTORS CONTAINED IN SECTION III (OUR COVERAGE OBLIGATION) OF THE HOME BUILDER’S LIMITED WARRANTY TO DETERMINE WHETHER A CONSTRUCTION DEFECT EXISTS AT YOUR HOME.

PLEASE REMEMBER THAT ALL REQUESTS MUST BE IN WRITING, UNLESS IT IS AN EMERGENCY.

ASPHALT DRIVEWAY	49
CERAMIC	34
COUNTERTOP & CABINET	36
DRYWALL	41
ELECTRICAL	44
EXCLUSIONS	1
EXTERIORS	11
EXTERIOR SIDING & CAULKING	17
FIREPLACE	19
FLOOR COVERING	29
FOUNDATION WATERPROOFING	9
FRAMING	11
HEATING AND COOLING	42
INTERIOR TRIM & CAULKING	27
INSULATION	12
LOT GRADING & DRAINAGE	3
MASONRY & CONCRETE	4
PAINTING AND STAINING	39
PLUMBING	45
ROOFING	13
WINDOWS AND DOORS	20

EXCLUSIONS

THE FOLLOWING ARE NOT COVERED UNDER THE FIRST YEAR HOME WARRANTY OR THE HOME BUILDER'S LIMITED WARRANTY:

1. ANY CONSTRUCTION DEFECTS OR OTHER DAMAGES RESULTING, EITHER DIRECTLY OR INDIRECTLY, FROM THE FOLLOWING CAUSES OR OCCURRING IN THE FOLLOWING SITUATIONS:
 - A. FIRE;
 - B. LIGHTNING;
 - C. EXPLOSION;
 - D. RIOT OR CIVIL COMMOTION;
 - E. SMOKE;
 - F. HAIL;
 - G. AIRCRAFT;
 - H. FALLING OBJECTS;
 - I. VEHICLES;
 - J. FLOODS;
 - K. EARTHQUAKE;
 - L. LANDSLIDE OR MUDSLIDE ORIGINATED ON PROPERTY OTHER THAN THE SITE OF THE HOME OR PROPERTY DEVELOPED BY THE BUILDER;
 - M. MINE SUBSIDENCE OR SINKHOLES;
 - N. CHANGES IN THE UNDERGROUND WATER TABLE NOT REASONABLY FORSEEABLE BY THE BUILDER;
 - O. VOLCANIC ERUPTION; EXPLOSION OR EFFUSION;
 - P. WIND, INCLUDING:
 - (I). GALE FORCE WINDS;
 - (II). HURRICANES;
 - (III). TROPICAL STORMS;
 - (IV). TORNADOES;
 - Q. INSECTS, ANIMALS OR VERMIN;
 - R. CHANGES IN THE GRADING OF THE GROUND BY ANYONE OTHER THAN US OR OUR AGENTS, OR SUBCONTRACTORS WHICH RESULTS IN SURFACE DRAINAGE TOWARDS THE HOME OR PERMITS WATER TO POND OR BECOME TRAPPED IN LOCALIZED AREAS AGAINST THE FOUNDATION;
 - S. CHANGES, ADDITIONS OR ALTERATIONS MADE TO THE HOME BY ANYONE OTHER THAN US OR OUR AGENTS, OR SUBCONTRACTORS;
 - T. ANY DEFECT IN MATERIAL OR WORKMANSHIP SUPPLIED BY ANYONE OTHER THAN US OR OUR AGENTS, OR SUBCONTRACTORS;
 - U. IMPROPER MAINTENANCE, NEGLIGENCE OR IMPROPER USE OF THE HOME BY YOU OR ANYONE ELSE THAT RESULTS IN ROT, DRY ROT, MOISTURE, RUST, MILDEW OR ANY OTHER DAMAGE;

- V. DAMPNESS OR CONDENSATION DUE TO YOUR FAILURE TO MAINTAIN ADEQUATE VENTILATION;
 - W. DAMAGE RESULTING FROM THE WEIGHT AND/OR PERFORMANCE OF ANY TYPE OF WATERBED OR OTHER FURNISHINGS WHICH EXCEEDS THE LOAD BEARING DESIGN OF THE HOME;
 - X. DAMAGE WHICH RESULTS FROM NORMAL WEAR AND TEAR OR NORMAL DETERIORATION OF MATERIALS;
2. ANY COSTS ARISING FROM, OR ANY CONSTRUCTION DEFECT RESULTING FROM THE ACTUAL, ALLEGED OR THREATENED DISCHARGE, DISPERSAL, RELEASE OR ESCAPE OF POLLUTANTS. WE WILL NOT COVER COSTS, OR EXPENSES ARISING FROM THE UNINHABITABILITY OF THE HOME OR HEALTH RISK DUE TO THE PROXIMITY OF POLLUTANTS. WE WILL NOT COVER COSTS, OR EXPENSES RESULTING FROM THE DIRECTION OF ANY GOVERNMENTAL ENTITY TO TEST, CLEAN-UP, REMOVE, TREAT, CONTAIN OR MONITOR POLLUTANTS;
 3. ANY COSTS ARISING FROM, OR ANY CONSTRUCTION DEFECT RESULTING FROM THE EFFECTS OF ELECTROMAGNETIC FIELDS (EMF'S) OR RADIATION;
 4. ANY DAMAGE TO PERSONAL PROPERTY THAT DOES NOT RESULT FROM A CONSTRUCTION DEFECT;
 5. ANY "CONSEQUENTIAL OR INCIDENTAL DAMAGES";
 6. ANY DAMAGE TO CONSUMER PRODUCTS;
 7. ANY CONSTRUCTION DEFECT WHICH YOU HAVE NOT TAKEN TIMELY AND REASONABLE STEPS TO PROTECT AND MINIMIZE DAMAGE AFTER WE OR OUR AUTHORIZED REPRESENTATIVE HAVE PROVIDED YOU WITH AUTHORIZATION TO PREVENT FUTURE DAMAGE;
 8. ANY NON-CONFORMITY WITH LOCAL BUILDING CODES, REGULATIONS OR REQUIREMENTS THAT HAS NOT RESULTED IN A CONSTRUCTION DEFECT. WHILE WE ACKNOWLEDGE OUR RESPONSIBILITY TO BUILD IN ACCORDANCE WITH APPLICABLE BUILDING CODES, THIS LIMITED-WARRANTY DOES NOT COVER BUILDING CODE VIOLATIONS IN THE ABSENCE OF A CONSTRUCTION DEFECT. THIS EXCLUSION IN NO WAY MITIGATES OR RELIEVES US OR OUR OBLIGATION TO BUILD IN ACCORDANCE WITH APPLICABLE BUILDING CODES, BUT THIS OBLIGATION IS NOT A WARRANTY.
 9. ANY DEVIATION FROM PLANS AND SPECIFICATIONS THAT HAS NOT RESULTED IN A CONSTRUCTION DEFECT.
- B. OUR LIMITED WARRANTY DOES NOT COVER ANY CONSTRUCTION DEFECT WHICH WOULD NOT HAVE OCCURRED IN THE ABSENCE OF ONE OR MORE OF THE EXCLUDED EVENTS OR CONDITIONS LISTED IN EXCLUSIONS, SECTION VI. A.1.A - A.1.Q., A.2 OR A.3 ABOVE, REGARDLESS OF:
1. THE CAUSE OF THE EXCLUDED EVENT OR CONDITION; OR
 2. OTHER CAUSES OF THE LOSS OR DAMAGE; OR
 3. WHETHER OTHER CAUSES ACTED CONCURRENTLY OR IN ANY SEQUENCE WITH THE EXCLUDED EVENT OR CONDITION TO PRODUCE THE LOSS OR DAMAGE.

LOT GRADING & DRAINAGE

**SETTLING OF
GROUND
AROUND
FOUNDATION
AND UTILITY
TRENCHES**

CONDITION

SETTLING OF GROUND AROUND FOUNDATION AND UTILITY TRENCHES.

PERFORMANCE STANDARD

BACKFILLED GROUND WILL SETTLE. THIS SETTLEMENT SHOULD NOT DISRUPT WATER DRAINAGE FROM THE HOUSE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOME OWNER/HOME OWNER'S ASSOCIATION WILL BE RESPONSIBLE FOR THE REMOVAL AND REPLACEMENT OF SHRUBS, ROCKS, LANDSCAPING, ETC. IN THE AFFECTED AREAS FOR THE BUILDER'S ONE TIME REPAIR. AFTER THIS ONE TIME REPAIR, IT WILL BE THE HOME OWNER'S RESPONSIBILITY TO FILL IN DEPRESSIONS AND MAINTAIN THE GRADE.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL FILL IN EXCESSIVELY SETTLED AREAS AND FINISH TO ORIGINAL SPECIFICATIONS PER CONTRACT ONLY ONCE TO MAINTAIN PROPER DRAINAGE.

**LOT NOT
DRAINING
PROPERLY**

CONDITION

LOT NOT DRAINING PROPERLY.

PERFORMANCE STANDARD

AFTER A NORMAL RAINFALL, WATER SHOULD NOT STAND IN THE YARD FOR MORE THAN 24 HOURS NOR 48 HOURS IN SWALES.

NOTE:

NO DECISIONS WILL BE MADE REGARDING DRAINAGE PROBLEMS WHILE FROST, SNOW OR SATURATION EXIST ON THE GROUND.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOME OWNER/HOME OWNER'S ASSOCIATION IS RESPONSIBLE FOR MAINTAINING PROPER GRADES AND SWALES WHICH HAVE BEEN ESTABLISHED BY THE BUILDER. AREAS THAT WERE NOT SODDED BY THE BUILDER WILL ALSO NEED TO BE MAINTAINED BY THE HOMEOWNER. PLEASE BE AWARE THAT UNSODDED AREAS SHOULD BE SEEDED OR SODDED AS SOON AS POSSIBLE TO PREVENT ANY EROSION THAT MAY DISRUPT THE PROPER DRAINAGE. THE BUILDER WILL NOT BE RESPONSIBLE FOR ANY MINOR DRAINAGE PROBLEMS IN AREAS THAT WERE NOT SODDED BY THE BUILDER. IF REGRADING IS REQUIRED, PLEASE CONTACT GOPHER STATE AT 454-0002 TO LOCATE YOUR UTILITY LINES.

BUILDER'S RESPONSIBILITY:THE BUILDER IS RESPONSIBLE FOR ESTABLISHING THE PROPER GRADE AND SWALES. THE BUILDER WILL NOT BE RESPONSIBLE FOR THE GRADE, IF THE ESTABLISHED GRADE HAS BEEN ALTERED.

MASONRY & CONCRETE

**CRACKING OF
BASEMENT
WALLS
(BLOCKS &
MORTAR
JOINTS)**

CONDITION

CRACKING OF BASEMENT WALLS (BLOCKS AND MORTAR JOINTS).

PERFORMANCE STANDARD

SETTLEMENT CRACKS ARE COMMON. ANY CRACKS GREATER THAN 1/4" IN WIDTH WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS BY SURFACE PATCHING OR TUCK POINTING. THE COLOR OF MORTAR WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**CRACKING OF
MASONRY
POURED
WALLS**

CONDITION

CRACKING OF MASONRY POURED WALLS.

PERFORMANCE STANDARD

CRACKS GREATER THAN 1/4" IN WIDTH WILL BE REPAIRED

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS BY SURFACE PATCHING OR TUCK POINTING. THE COLOR OF THE FILLER WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**CRACKING OF
BASEMENT
FLOORS**

CONDITION

CRACKING OF BASEMENT FLOOR.

PERFORMANCE STANDARD

SHRINKAGE CRACKS ARE A DIRECT RESULT FROM THE SHRINKAGE OF MATERIAL DURING THE HARDENING PROCESS OF POURED CONCRETE.

BASEMENT FLOORS ARE SINGLE SLABS RESULTING FROM ONE CONTINUOUS POUR OF CONCRETE. SHRINKAGE CRACKS MAY DEVELOP DURING THE CURING PROCESS. THESE CRACKS DO NOT AFFECT THE STRENGTH OF THE CONCRETE. ANY CRACKS GREATER THAN 1/4" IN WIDTH OR 1/4" VERTICAL DISPLACEMENT WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS BY PATCHING OR USING OTHER FILLER REMEDIES. THE COLOR OF FILLER WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**CRACKING OF
GARAGE SLAB**

CONDITION
CRACKING OF GARAGE SLAB.

PERFORMANCE STANDARD

DUE TO WEATHER VARIATIONS AND SETTLING, MORE MOVEMENT SHOULD BE EXPECTED IN GARAGE SLABS. SHRINKAGE OR SETTLEMENT CRACKS ARE COMMON AND THEY DO NOT AFFECT THE STRENGTH OF THE CONCRETE. ANY CRACKS EXCEEDING 1/4" IN WIDTH OR 1/4" IN VERTICAL DISPLACEMENT WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS BY PATCHING OR USING OTHER FILLER REMEDIES. THE COLOR OF FILLER WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**HEAVING
EXTERIOR
CONCRETE
SLAB**

CONDITION
**HEAVING EXTERIOR CONCRETE SLABS - VERTICAL OR HORIZONTAL
MOVEMENT OF CONCRETE SLABS AT JOINTS.**

PERFORMANCE STANDARD

CONCRETE SLABS ARE DESIGNED TO MOVE AT EXPANSION JOINTS.

RESPONSIBILITY

(SEE SETTLING OF PATIO'S, SIDEWALK'S. AND DRIVEWAY'S FOR FURTHER INFORMATION ON PAGE 7.)

**DEPRESSIONS OR
UNEVENNESS IN
HABITABLE
CONCRETE
FLOORS**

CONDITION
**DEPRESSIONS OR UNEVENNESS IN HABITABLE
CONCRETE FLOORS.**

PERFORMANCE STANDARD

IF THE DEPRESSION OR UNEVENNESS EXCEEDS 1/4" IN A 32" MEASUREMENT, IT WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE PROBLEM TO MEET THE PERFORMANCE STANDARD BY FILLING WITH A LATEX OR EQUIVALENT FILLER OR BY GRINDING. THE FINISHED REPAIR WILL BE FEATHERED IN. COLOR VARIATIONS OF CONCRETE ARE TO BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS. IN CASES WHERE CARPET OR ANOTHER FLOOR MATERIAL HAS BEEN INSTALLED, THAT MATERIAL WILL BE LIFTED, THE CONCRETE WILL BE REPAIRED AND THE CARPET OR OTHER MATERIAL WILL BE REINSTALLED.

**PITTING,
SCALING OR
SPALLING OF
CONCRETE
(AGGREGATE
LOOSE)**

CONDITION

PITTING, SCALING OR SPALLING OF CONCRETE (AGGREGATE LOOSE).

PERFORMANCE STANDARD

CONCRETE IS AFFECTED BY CERTAIN ELEMENTS AND CHEMICALS. REPEATED THAWING AND FREEZING, THE USAGE OF SALT AND CHEMICALS CAN DAMAGE CONCRETE.

THE BUILDER WILL CORRECT ONLY LARGE AREAS WHERE THE AGGREGATE HAS BECOME LOOSE AND HAS NOT BEEN CAUSED BY THE CONCENTRATION OF WATER, FREEZING AND THAWING, OR THE USE OF CHEMICALS AND SALT.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOME OWNER/HOME OWNER'S ASSOCIATION WILL PROTECT THE SURFACE OF THE CONCRETE BY KEEPING IT FREE AND CLEAR OF ICE AND SNOW AND WILL NOT USE SALT BASED PRODUCTS ON THE CONCRETE.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE AFFECTED SURFACE WITH A CONCRETE FILLER. THE COLOR OF FILLER WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**POWDERING
OR CHALKING
OF CONCRETE**

CONDITION

POWDERING OR CHALKING OF CONCRETE.

PERFORMANCE STANDARD

CONCRETE SURFACES SHOULD NOT CHALK OR POWDER. IF THE SURFACE CONTINUES TO DEGENERATE AND BECOME ROUGH OR EXPOSE AGGREGATE, CORRECTIVE ACTION WILL BE NECESSARY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE AFFECTED SURFACE WITH A CONCRETE FILLER OR SEALER. THE COLOR OF FILLER OR SEALER WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**DISCOLORING
OF CONCRETE**

CONDITION

DISCOLORING OF CONCRETE.

PERFORMANCE STANDARD

CONCRETE MAY DISCOLOR FROM WATER RUNNING OVER THE CONCRETE, DUE TO HIGH MINERAL CONTENT IN EITHER THE GROUND WATER OR THE MUNICIPAL WATER SUPPLY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE: CONCRETE DISCOLORATION IS UNCONTROLLABLE AND IS NOT A WARRANTED ITEM.

**DISCOLORING
OF BRICKS**

**CONDITION
DISCOLORING OF BRICKS.**

PERFORMANCE STANDARD
BRICKS MAY DISCOLOR DUE TO THE ELEMENTS, RAIN RUN-OFF WEATHERING OR ITS INNATE MATERIALS.

RESPONSIBILITY
HOME OWNER'S RESPONSIBILITY: WHEN THE BRICK SURFACE HAS DRIED, THIS DISCOLORATION CAN BE REMOVED BY USING A WIRE BRUSH ON THE DISCOLORED AREA.

BUILDER'S RESPONSIBILITY: NONE: BRICK DISCOLORATION IS UNCONTROLLABLE AND IS NOT A WARRANTED ITEM.

**CRACKING OF
PATIOS, SIDE-
WALKS AND
DRIVEWAYS**

**CONDITION
CRACKING OF PATIOS, SIDEWALKS, AND DRIVEWAYS.**

PERFORMANCE STANDARD
SETTLEMENT CRACKS ARE COMMON AND SHOULD BE EXPECTED, CRACKS EXCEEDING 1/4" IN WIDTH OR 1/4" IN VERTICAL DISPLACEMENT WILL BE CORRECTED.

RESPONSIBILITY
HOME OWNER'S RESPONSIBILITY: NONE
BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR OR REPLACE THE MINIMUM AFFECTED SECTION OF CONCRETE WHICH CAN BE REMOVED FROM THE SIDEWALK, DRIVEWAY OR PATIO AT THE OPEN JOINTS. COLOR VARIATIONS OF CONCRETE CAN BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**SETTLING OF
PATIOS, SIDE-
WALKS AND
DRIVEWAYS**

**CONDITION
SETTLING OF PATIOS, SIDEWALKS AND DRIVEWAYS.**

PERFORMANCE STANDARD
CONCRETE SLABS THAT HAVE SETTLED 1" OR MORE FROM THEIR ORIGINAL POSITION AND WHERE NEGATIVE DRAINAGE HAS RESULTED WILL BE CORRECTED ONE TIME ONLY.

RESPONSIBILITY
HOME OWNER'S RESPONSIBILITY: NONE
BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR OR REPLACE ONE TIME ONLY THE MINIMUM AFFECTED SECTION WHICH CAN BE REMOVED FROM THE SIDEWALK, DRIVEWAY OR PATIO AT THE OPEN JOINTS. COLOR VARIATIONS OF CONCRETE CAN BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**CRACKING OF
STOOPS FROM
FOUNDATIONS**

CONDITION

CRACKING OF STOOPS FROM FOUNDATIONS.

PERFORMANCE STANDARD

MINOR SEPARATING IS NORMAL. SEPARATION OF MORE THAN 1" WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL TAKE WHATEVER CORRECTIVE ACTION IS REQUIRED TO MEET THE PERFORMANCE STANDARD. COLOR VARIATIONS OF CONCRETE CAN BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**CRACKING OF
MASONRY OR
VENEER
WALLS**

CONDITION

CRACKING OF MASONRY OR VENEER WALLS.

PERFORMANCE STANDARD

CRACKS GREATER THAN 1/4" IN WIDTH WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS BY SURFACE PATCHING OR TUCK POINTING. THE COLOR OF MORTAR WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

FOUNDATION WATERPROOFING

DAMP BASEMENT WALLS

CONDITION

DAMP BASEMENT WALLS.

PERFORMANCE STANDARD

DAMP FOUNDATION WALLS ARE COMMON AND ARE A NATURAL OCCURRENCE OF CONDENSATION DURING THE SUMMER MONTHS. DAMP WALLS SHOULD NOT BE CONFUSED WITH A “WET BASEMENT,” DEFINED AS ACTUAL WATER RUNNING THROUGH OR UNDER THE BASEMENT WALL AND ONTO THE FLOOR AND PUDDLING.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: NORMALLY, DAMP BASEMENT WALLS CAN BE DRIED OUT BY DOING THE FOLLOWING:

1. VENTILATE OR “AIR OUT” THE BASEMENT BY OPENING THE WINDOWS AND TURNING ON A FAN TO CIRCULATE THE AIR.
2. USE A DEHUMIDIFIER.
3. IF THE PLASTIC COVERING FOR THE WALL INSULATION IS TIGHTLY SECURED, LOOSEN THE PLASTIC AT THE TOP AND BOTTOM TO ALLOW AIR TO CIRCULATE BEHIND IT.

BUILDER’S RESPONSIBILITY: NONE: DAMPNES ON THE BASEMENT WALLS IS NORMAL AND IS NOT A WARRANTED ITEM.

WATER LEAKAGE INTO BASEMENT

CONDITION

WATER LEAKING INTO BASEMENT (OR WET BASEMENT).

PERFORMANCE STANDARD


ACTUAL LEAKAGE OR FLOW OF WATER THAT ACCUMULATES INTO THE BASEMENT WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: TO INSURE THAT WATER DRAINS AWAY FROM THE HOME, THE FOLLOWING PRECAUTIONS SHOULD BE TAKEN BY HOMEOWNER/HOME OWNER’S ASSOCIATION:

- 1) MAINTAIN THE GRADING SO IT SLOPES AWAY FROM THE FOUNDATION.
- 2) KEEP WINDOW WELLS FREE OF DEBRIS AND VEGETATION. INSTALL WINDOW WELL COVERS.
- 3) IF LANDSCAPING ROCK, WOOD CHIPS, ETC. ARE USED AROUND THE FOUNDATION OF THE HOME, IT IS ESSENTIAL TO INSTALL THIS MATERIAL CORRECTLY SO WATER POCKETS DO NOT DEVELOP AND WATER DOES NOT BECOME TRAPPED AND LEAK INTO THE BASEMENT. (SEE DIAGRAM ON NEXT PAGE FOR PROPER INSTALLATION.) IT IS ALSO RECOMMENDED TO USE A POLY/PLASTIC SHEETING UNDER ROCKS OR MULCH BEDS THAT SURROUND FOUNDATIONS.

(CONTINUED)

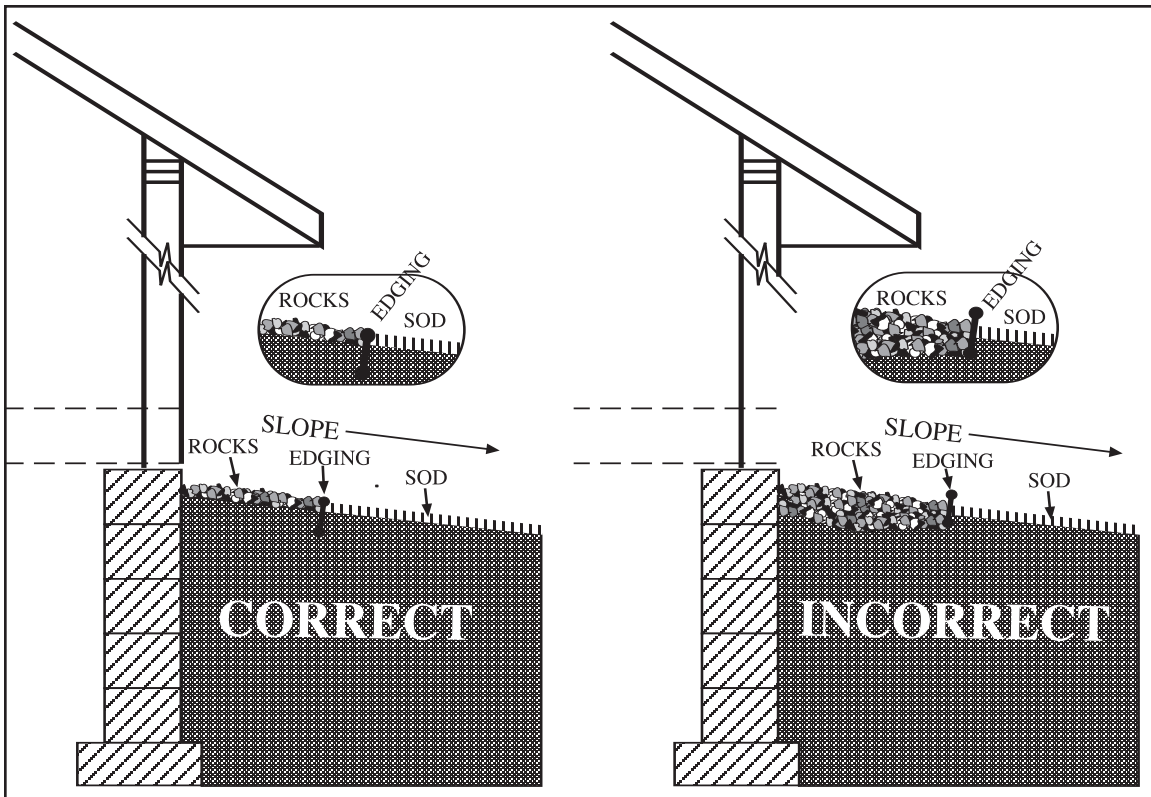

(CONTINUED)

LANDSCAPING TIP: MOST BASEMENT WATER PROBLEMS ARE CAUSED BY INCORRECT AND EXCESSIVE INSTALLATIONS OF DECORATIVE ROCK.

4) CONSIDER INSTALLING GUTTERS AND DOWN SPOUTS.

BUILDER'S RESPONSIBILITY: ACTUAL LEAKAGE OF WATER INTO THE BASEMENT WILL BE CORRECTED. THE BUILDER WILL NOT BE RESPONSIBLE IF THE CAUSE IS DUE TO IMPROPER LANDSCAPING, MAINTENANCE OR NEGLIGENCE BY THE HOMEOWNER.

EXTERIOR

EXTERIOR REPAIRS NEEDED

CONDITION

EXTERIOR REPAIRS NEEDED

RESPONSIBILITY

HOME OWNER'S ASSOCIATION: PLEASE CONTACT YOUR ASSOCIATION'S MANAGEMENT COMPANY TO REPORT ANY EXTERIOR DAMAGE, OR REPAIRS THAT ARE NEEDED AFTER THE ONE YEAR WARRANTY HAS EXPIRED.

BUILDER'S RESPONSIBILITY: NONE

FRAMING

OUT OF PLUMB OR BOWED WALLS

CONDITION

OUT OF PLUMB OR BOWED WALLS.

PERFORMANCE STANDARD

WALLS BOWING MORE THAN 1/4" WITHIN A 32" MEASUREMENT (FLOOR TO CEILING OR WALL-TO-WALL) WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE WALL BY MUD FEATHERING THE WALL. MORE SEVERE CASES MAY REQUIRE OTHER REMEDIES. THE BUILDER WILL TRY TO MATCH THE TEXTURE AND COLOR AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR THESE VARIATIONS.

SQUEAKING OF FLOOR OR LOOSE SUB- FLOOR

CONDITION

SQUEAKING OF FLOOR OR LOOSE SUB-FLOOR

PERFORMANCE STANDARD

FLOOR SQUEAKS WILL GENERALLY APPEAR AND DISAPPEAR DUE TO THE SETTLING OF THE HOME AND CHANGES IN THE WEATHER. A CERTAIN AMOUNT OF FLOOR SHRINKAGE IS NORMAL AND COMPLETE AVOIDANCE OF FLOOR SQUEAKS IS IMPOSSIBLE AND CANNOT BE GUARANTEED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: BY MAINTAINING THE HUMIDITY LEVEL BETWEEN 30-50 PERCENT, THIS WILL HELP REDUCE THE NUMBER OF FLOOR SQUEAKS.

BUILDER'S RESPONSIBILITY: FLOOR SQUEAK REPAIRS WILL BE CORRECTED NO MORE THAN ONE TIME DURING THE FIRST YEAR WARRANTY PERIOD. TO ALLOW THE HOUSE TO STABILIZE ITSELF, THE BUILDER WILL REPAIR THE SQUEAKS DURING THE ELEVENTH MONTH OF THE FIRST YEAR WARRANTY PERIOD. THE BUILDER WILL CORRECT THE SQUEAK ONLY IF CAUSED BY AN UNDERLYING CONSTRUCTION DEFECT. THE SQUEAK WILL BE REPAIRED, AT THE BUILDER'S SOLE OPTION, IN ONE OF THE FOLLOWING MANNERS:

1. FACE NAILING
2. SCEWING THE FLOOR FROM BELOW
3. PULLING UP THE FLOOR COVERING AND SCREWING THE MAIN FLOOR FROM ABOVE.
4. SHIMMING BETWEEN THE FLOOR JOIST AND THE FLOOR IN THE BASEMENT AT THE POINT OF THE SQUEAK.

INSULATION

CONDITION

PIPES FREEZING.

(SEE PLUMBING)

CONDITION

MOISTURE CONDENSATION OR FROSTING ON WINDOWS.

(SEE WINDOWS & DOORS)

DRAFTS AT BASEBOARD

CONDITION

DRAFTS AT BASEBOARD.

PERFORMANCE STANDARD

THE BUILDER WILL INSPECT THE DRAFT TO DETERMINE IF INADEQUATE INSULATION WAS SUPPLIED. PLEASE NOTE THAT THE JUNCTURE OF THE FLOOR AND THE WALL SYSTEM IS CONDUCTIVE TO OPENINGS SO A CERTAIN AMOUNT OF AIR MOVEMENT IS PERMISSIBLE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CHECK THE AFFECTED AREAS AND CORRECT IF NECESSARY.

CONDITION

DRAFTS AROUND WINDOWS AND DOORS.

(SEE WINDOWS & DOORS)

DRAFTS FROM ELECTRICAL OUTLETS

CONDITION

DRAFTS FROM ELECTRICAL OUTLETS.

PERFORMANCE STANDARD

ELECTRIC BOXES ON EXTERIOR WALLS PRODUCE AN AIR FLOW PASSAGE WHEREBY OUTSIDE AIR CAN BE DRAWN THROUGH THE OUTLET INTO THE ROOM. THIS PROBLEM IS VIRTUALLY UNAVOIDABLE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO MINIMIZE AIR DRAFTS, THE HOMEOWNER CAN PURCHASE OUTLET INSULATORS AT ANY HARDWARE STORE.

BUILDER'S RESPONSIBILITY: NONE

ROOFING

ICE BUILD-UP ON ROOF

CONDITION

ICE BUILD-UP ON ROOF.

PERFORMANCE STANDARD

DURING ALTERNATE FREEZING AND THAWING CONDITIONS, ICE BUILD UP IS LIKELY TO OCCUR AT THE EAVES OF THE ROOF. THIS CONDITION OCCURS WHEN SNOW AND ICE ACCUMULATES AND GUTTERS AND DOWN SPOUTS FREEZE UP. THIS TYPE OF LEAKAGE IS NOT COVERED BY THE BUILDER AND IS A HOME OWNER'S RESPONSIBILITY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOMEOWNER/HOME OWNER'S ASSOCIATION CAN PREVENT THIS PROBLEM BY REMOVING LEAF BUILD UP IN GUTTERS AND REMOVING EXCESS SNOW AND ICE.

BUILDER'S RESPONSIBILITY: NONE

ROOF OR FLASHING LEAKS

CONDITION

ROOF OR FLASHING LEAKS.

PERFORMANCE STANDARD

ALL ROOF AND FLASHING LEAKS NOT CAUSED BY SNOW OR ICE BUILD-UP OR HOME OWNER'S ACTION OR NEGLIGENCE WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOMEOWNER/HOME OWNER'S ASSOCIATION SHOULD REMOVE LEAF BUILD UP IN GUTTERS AND REMOVE EXCESS SNOW AND ICE.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE LEAK IF THE CAUSE IS NOT DUE TO THE HOME OWNER'S ACTIONS OR NEGLIGENCE. IF SHINGLE REPLACEMENT IS REQUIRED, PLEASE NOTE THAT BECAUSE THE PROCESS OF COATING SHINGLES WITH COLORED GRANULES IS A BATCH-TYPE PROCESS, DIFFERENT DYE LOTS WILL OCCUR. THEREFORE, COLOR VARIATIONS IN THE SHINGLES CAN ARISE FROM THIS PROCESS. THE BUILDER IS NOT RESPONSIBLE FOR COLOR VARIATIONS.

**LEAKING
THROUGH
VENTS OF
LOUVERS DUE
TO SNOW OR
DRIVEN RAIN**

CONDITION

LEAKING THROUGH LOUVERS OR VENTS DUE TO SNOW OR DRIVEN RAIN.

PERFORMANCE STANDARD

VENTS OR LOUVERS MUST BE PROVIDED FOR PROPER VENTILATION. EVEN IF VENTS ARE INSTALLED ACCORDING TO BUILDING CODES, DRIVING SNOW OR RAIN MAY ENTER. THIS IS NOT A DEFECT. VENTS OR LOUVERS SHOULD NOT LEAK UNDER NORMAL CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: LEAKS THAT OCCUR UNDER NORMAL CONDITIONS WILL BE REPAIRED BY THE BUILDER. IF SHINGLE REPLACEMENT IS REQUIRED, PLEASE NOTE THAT BECAUSE THE PROCESS OF COATING SHINGLES WITH COLORED GRANULES IS A BATCH-TYPE PROCESS, DIFFERENT DYE LOTS WILL OCCUR. THEREFORE, COLOR VARIATIONS IN THE SHINGLES CAN ARISE FROM THIS PROCESS. THE BUILDER IS NOT RESPONSIBLE FOR COLOR VARIATIONS.

**WIND DAMAGE
TO ROOF
SHINGLES**

CONDITION

WIND DAMAGE TO ROOF SHINGLES.

PERFORMANCE STANDARD

SHINGLES SHOULD NOT BLOW OFF DURING THE FIRST YEAR WARRANTY PERIOD UNDER NORMAL WEATHER CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IF SHINGLES ARE DAMAGED BY ABNORMAL WEATHER CONDITIONS, THE MATTER SHOULD BE PROCESSED BY THE HOME OWNER/HOME OWNER'S ASSOCIATION AS AN INSURANCE CLAIM.

BUILDER'S RESPONSIBILITY: UNDER NORMAL WEATHER CONDITIONS, THE BUILDER WILL REPAIR OR REPLACE THE DAMAGED SHINGLES. IF SHINGLE REPLACEMENT IS REQUIRED, PLEASE NOTE THAT BECAUSE THE PROCESS OF COATING SHINGLES WITH COLORED GRANULES IS BATCH-TYPE PROCESS, DIFFERENT DYE LOTS WILL OCCUR. THEREFORE, COLOR VARIATIONS IN THE SHINGLES CAN ARISE FROM THIS PROCESS. THE BUILDER IS NOT RESPONSIBLE FOR COLOR VARIATIONS.

**SHINGLES
STICKING UP,
NOT SEALING
DOWN**

CONDITION

SHINGLES STICKING UP OR NOT SEALING DOWN.

PERFORMANCE STANDARD

SHINGLES SHOULD BE SEALED BY THE END OF THE FIRST WARRANTY PERIOD. WHERE A NON-SEALING TYPE OF SHINGLE HAS BEEN USED, THE BUILDER CAN CORRECT THE NAILING DEFICIENCY BY SEALING DOWN THE SHINGLES. WITH SEALING TYPE SHINGLES, THESE SHINGLES REQUIRE HEAT FROM THE SUN TO AFFECT THE FULL SEAL, SO SOME WARM WEATHER IS REQUIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR SHINGLES THAT ARE NOT SEALED BY THE END OF THE FIRST YEAR WARRANTY PERIOD. IF SHINGLE REPLACEMENT IS REQUIRED, PLEASE NOTE THAT BECAUSE THE PROCESS OF COATING SHINGLES WITH COLORED GRANULES IS A BATCH-TYPE PROCESS, DIFFERENT DYE LOTS WILL OCCUR. THEREFORE, COLOR VARIATIONS IN THE SHINGLES CAN ARISE FROM THIS PROCESS. THE BUILDER IS NOT RESPONSIBLE FOR COLOR VARIATIONS.

**SHINGLES DO
NOT OVER-
HANG ROOF
EDGE...OR
HANG OVER
TOO FAR**

CONDITION

SHINGLES DO NOT OVERHANG EDGES OF ROOF, OR HANG TOO FAR OVER THE EDGES OF ROOF.

PERFORMANCE STANDARD

SHINGLES WILL OVERHANG ROOF EDGES BY NOT LESS THAN 1/4", AND NOT MORE THAN 3/4".

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPOSITION OR REPLACE SHINGLES AS NECESSARY TO MEET THE ACCEPTABLE STANDARD. IF SHINGLE REPLACEMENT IS REQUIRED, PLEASE NOTE THAT BECAUSE THE PROCESS OF COATING SHINGLES WITH COLORED GRANULES IS A BATCH-TYPE PROCESS, DIFFERENT DYE LOTS WILL OCCUR. THEREFORE, COLOR VARIATIONS IN THE SHINGLES CAN ARISE FROM THIS PROCESS. THE BUILDER IS NOT RESPONSIBLE FOR COLOR VARIATIONS.

**MISMATCH
OF SHINGLE
COLOR**

CONDITION

MISMATCH OF SHINGLE COLOR.

PERFORMANCE STANDARD

NONE: SOME COLOR MISMATCHES DO OCCUR BECAUSE OF SUN REFLECTIONS, MINOR DIFFERENCES IN COLORS BETWEEN SHINGLES IN THE SAME LOTS, AND THE AGING AND WEATHERING OF SHINGLES.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE

**LEAKS IN
GUTTERS OR
DOWNSPOUTS**

CONDITION

LEAKS IN GUTTERS OR DOWN SPOUTS.

PERFORMANCE STANDARD

GUTTERS AND DOWN SPOUTS SHOULD NOT LEAK, HOWEVER DURING HEAVY RAINS, OVERFLOW SHOULD BE EXPECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IT IS A HOMEOWNER/HOME OWNER'S ASSOCIATION'S RESPONSIBILITY TO KEEP GUTTERS AND DOWN SPOUTS FREE OF LEAVES AND DEBRIS WHICH COULD CAUSE OVERFLOW.

BUILDER'S RESPONSIBILITY: LEAKS NOT CAUSED BY HOME OWNER'S NEGLIGENCE OR DAMAGE WILL BE REPAIRED BY THE BUILDER.

**WATER
STANDING IN
GUTTERS**

CONDITION

WATER STANDING IN GUTTERS.

PERFORMANCE STANDARD

IF THE GUTTER IS FREE FROM DEBRIS, THE WATER LEVEL SHOULD NOT EXCEED 1" IN DEPTH.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IT IS A HOMEOWNER/HOME OWNER'S ASSOCIATION'S RESPONSIBILITY TO KEEP GUTTERS AND DOWN SPOUTS FREE OF LEAVES AND DEBRIS WHICH COULD CAUSE OVERFLOW.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE GUTTER TO MEET THE PERFORMANCE STANDARD.

**INADEQUATE
ATTIC OR ROOF
VENTILATION**

CONDITION

INADEQUATE ATTIC OR ROOF VENTILATION.

PERFORMANCE STANDARD

ATTIC SPACES WILL BE VENTILATED AS REQUIRED BY APPLICABLE BUILDING CODES.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL PROVIDE ADEQUATE VENTILATION TO MEET THE PERFORMANCE STANDARDS.

EXTERIOR SIDING & CAULKING

JOINT
SEPERATIONS
OR GAPS
BETWEEN
SIDING

CONDITION

JOINT SEPARATIONS OR GAPS BETWEEN SIDING.

PERFORMANCE STANDARD

SEPARATION BETWEEN SIDING SHOULD NOT EXCEED 3/8".

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SEPARATION BY CAULKING OR USING OTHER REMEDIES. THE HOMEOWNER CAN EXPECT THAT THE NEWLY PAINTED SURFACE MAY NOT MATCH THE ORIGINAL SURFACE IN COLOR. THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS

KNOTS OF
SPLITTING OF
WOOD SIDING

CONDITION

KNOTS OR SPLITTING OF WOOD SIDING.

PERFORMANCE STANDARD

SOME SPLITTING OF WOOD IS NORMAL AND SHOULD BE EXPECTED. SPLITS EXCEEDING 1/4" WILL BE REPAIRED. KNOTS ARE A NATURAL CHARACTER OF THE WOOD AND ARE NOT CONSIDERED DEFECTS OF THE WOOD.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: AT THE BUILDER'S SOLE OPTION, THE BUILDER WILL REPAIR (BY CAULKING) OR REPLACE THE AFFECTED AREAS AS REQUIRED. THE HOME OWNER CAN EXPECT THAT THE NEWLY PAINTED SURFACE MAY NOT MATCH THE ORIGINAL SURFACE IN COLOR. THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

LOOSE SIDING

CONDITION

LOOSE SIDING.

PERFORMANCE STANDARD

SIDING SHOULD NOT BECOME LOOSE IN THE FIRST YEAR WARRANTY PERIOD UNDER NORMAL WEATHER CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IF SIDING BECOMES LOOSE UNDER WINDY OR ABNORMAL WEATHER CONDITIONS, THE HOME OWNER/HOME OWNER'S ASSOCIATION SHOULD PROCESS THE MATTER AS AN INSURANCE CLAIM.

BUILDER'S RESPONSIBILITY: SIDING THAT BECOMES LOOSE UNDER NORMAL WEATHER CONDITIONS WILL BE CORRECTED BY THE BUILDER. THE HOMEOWNER CAN EXPECT THAT THE NEWLY REPAIRED SURFACE MAY NOT MATCH THE ORIGINAL SURFACE IN COLOR OR TEXTURE. THE BUILDER WILL NOT BE RESPONSIBLE FOR SUCH VARIATIONS.

**EXTERIOR
WALLS LEAK
DUE TO
CAULKING
SHRINKAGE**

CONDITION

EXTERIOR WALL LEAKS DUE TO CAULKING SHRINKAGE.

PERFORMANCE STANDARD

JOINTS AND CRACKS OF WALL SURFACES WILL BE RECAULKED ONCE TO PREVENT ENTRY OF WATER.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: DUE TO ATMOSPHERIC CONDITIONS, ALL CAULKING WILL SHRINK AND DRY OUT. CAULKING AROUND ALL DOORS, WINDOWS, SKYLIGHTS, OPEN SIDING SEAMS, VENTS, THRESHOLDS, OPENINGS IN FOUNDATION FOR PLUMBING AND ELECTRIC SERVICE, AND TRIM SHOULD BE EXAMINED AT LEAST ONCE A YEAR. REPAIR AND/OR REPLACEMENT IS A HOMEOWNER/HOME OWNER'S ASSOCIATION MAINTENANCE RESPONSIBILITY

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR CRACKS (USING CAULK) AS REQUIRED TO CORRECT DEFICIENCIES ONCE DURING THE WARRANTY PERIOD. PLEASE NOTE THAT PROPERLY INSTALLED CAULKING WILL SHRINK AND MUST BE MAINTAINED DURING THE LIFE OF THE HOME. THE COLOR OF CAULK OR PAINT WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR VARIATIONS.

FIREPLACE

**FIREPLACE
DOES NOT
DRAW
ENOUGH OR
DOWN DRAFT**

CONDITION

FIREPLACE DOES NOT DRAW ENOUGH OR DOWN DRAFT.

PERFORMANCE STANDARD

FIREPLACES SHOULD FUNCTION PROPERLY. IT IS NORMAL TO EXPECT THAT HIGH WINDS CAN CAUSE DOWN DRAFTS. ALSO, LARGE BRANCHES OF TREES TOO CLOSE TO THE CHIMNEY WILL CAUSE SIMILAR DOWN DRAFTS. SOME HOMES ARE EXTREMELY AIR TIGHT AND MAY NEED TO HAVE A WINDOW OPENED SLIGHTLY TO CREATE AN EFFECTIVE DRAFT.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY:

GAS FIREPLACES: TO PREVENT HEAT FROM ESCAPING AND DOWN DRAFTS, IT IS RECOMMENDED THAT THE FIREPLACE GLASS DOORS ARE KEPT SHUT AT ALL TIMES.

BUILDER'S RESPONSIBILITY: IF THE PROBLEM IS CAUSED BY IMPROPER CONSTRUCTION OR DESIGN, THE BUILDER WILL CORRECT THIS.

**CRACKING OF
FIREPLACE
BRICK
VENEER**

CONDITION

CRACKING OF FIREPLACE BRICK VENEER.

PERFORMANCE STANDARD

CRACKS IN THE BRICK VENEER GREATER THAN 1/4" IN WIDTH WILL BE REPAIRED

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT CRACKS THAT EXCEED THE PERFORMANCE STANDARD BY PATCHING OR TUCK POINTING. THE COLOR OF MORTAR WILL BE MATCHED AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**COLOR
VARIATIONS
OF NATURAL
MARBLE**

CONDITION

COLOR VARIATIONS OF NATURAL MARBLE SURROUND AND/OR HEARTH.

PERFORMANCE STANDARD

ALL NATURAL MARBLE PRODUCTS HAVE VARIATIONS IN GRAIN AND COLOR. THE VARIATIONS CANNOT BE CONTROLLED AND ARE NOT WARRANTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE

WINDOWS & DOORS

WARPAGE OF EXTERIOR DOORS

CONDITION

WARPAGE OF EXTERIOR DOORS.

PERFORMANCE STANDARD

DUE TO TEMPERATURE DIFFERENCES ON THE INSIDE AND OUTSIDE SURFACES, SOME TEMPORARY WARPING MAY OCCUR. THIS TEMPORARY WARPAGE IS NOT A DEFECT AND THE DOOR WILL IN MOST CASES STRAIGHTEN AGAIN AS THE TEMPERATURE CHANGES. HOWEVER, DOORS SHOULD NOT BECOME INOPERABLE, OR FAIL TO BE WEATHER RESISTANT, AND WARPAGE SHOULD NOT EXCEED 1/4" MEASURED FROM CORNER TO CORNER DIAGONALLY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: AT THE BUILDER'S SOLE OPTION, THE BUILDER WILL REPAIR OR REPLACE WARPED DOORS. IF REPLACEMENT IS REQUIRED, THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

DENTS IN THE EXTERIOR METAL DOOR(S)

CONDITION

DENTS IN THE EXTERIOR METAL DOOR(S).

PERFORMANCE STANDARD

DENTS NOT REPORTED TO THE BUILDER BEFORE OCCUPANCY BY THE HOMEOWNER WILL NOT BE COVERED UNDER THIS WARRANTY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: AFTER THE CUSTOMER ORIENTATION, THE BUILDER WILL NOT REPAIR DENTS; OR REPLACE EXTERIOR DOORS. THIS IS A HOME OWNER MAINTENANCE ITEM.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR BY FILLING, SANDING AND PAINTING ANY DENTS TO THE THE EXTERIOR DOORS WHICH WERE NOTED ON THE ORIGINAL ACCEPTANCE OF CONSTRUCTION FORM.

**DRAFTS
UNDER
EXTERIOR
DOORS**

CONDITION

DRAFTS UNDER EXTERIOR DOORS.

PERFORMANCE STANDARD

DRAFTS COMING UNDERNEATH THE EXTERIOR DOORS CAN BE CORRECTED BY ADJUSTING THE DOOR THRESHOLD.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: EXTERIOR DOOR THRESHOLDS CAN BE ADJUSTED BY COMPLETING THE FOLLOWING STEPS:

- 1.) WITH THE USE OF A PHILLIPS HEAD SCREWDRIVER, LOOSEN THE SMALL SCREWS ON THE THRESHOLD STARTING LEFT TO RIGHT. AS EACH SCREW IS LOOSENED MAKE SURE THE THRESHOLD REMAINS LEVEL WITH THE BOTTOM OF THE DOOR.
- 2.) USING A STANDARD SCREWDRIVER, EITHER TIGHTEN THE LARGE SCREWS TO LOWER THE THRESHOLD OR LOOSEN THEM TO RAISE THE THRESHOLD. THE THRESHOLD ADJUSTMENT SHOULD CREATE A SEAL BETWEEN THE DOOR AND THE THRESHOLD. TO PREVENT TEARING OF THE BOTTOM DOOR SWEEP, THE THRESHOLD SHOULD NOT BE ADJUSTED TOO TIGHTLY.
- 3.) ONE THE PROPER ADJUSTMENT HAS BEEN MADE, TIGHTEN THE SMALL SCREWS WITH THE PHILLIPS HEAD SCREWDRIVER.

BUILDER'S RESPONSIBILITY: NONE

**SLIDING
PATIO
SCREEN
DOORS WILL
NOT STAY ON
TRACK**

CONDITION

SLIDING PATIO SCREEN DOORS WILL NOT STAY ON TRACK.

PERFORMANCE STANDARD

SLIDING PATIO SCREEN DOORS WILL SLIDE PROPERLY ON THEIR TRACKS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE CLEANING MAINTENANCE NECESSARY TO PRESERVE PROPER OPERATION IS THE RESPONSIBILITY OF THE HOMEOWNER.

BUILDER'S RESPONSIBILITY: SCREEN DOORS NOT CAUSED BY HOMEOWNERS NEGLECT OR DAMAGE WILL BE REPAIRED BY THE BUILDER.

**SLIDING
PATIO DOORS
DO NOT ROLL
SMOOTHLY**

CONDITION

SLIDING PATIO DOORS DO NOT ROLL SMOOTHLY.

PERFORMANCE STANDARD

SLIDING PATIO DOORS WILL ROLL SMOOTHLY WITH REASONABLE EASE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE CLEANING AND MAINTENANCE NECESSARY TO PRESERVE PROPER OPERATION IS THE RESPONSIBILITY OF THE HOMEOWNER. THE DOOR MAY BE ADJUSTED TO ROLL EASIER BY USING THE ADJUSTMENT SCREWS LOCATED ON THE EXTERIOR OF THE DOOR AT THE TOP AND BOTTOM.

BUILDER'S RESPONSIBILITY: SLIDING PATIO DOORS NOT CAUSED BY THE HOME OWNER'S NEGLECT OR DAMAGE WILL BE REPAIRED BY THE BUILDER.

**WARPAGE OF
INTERIOR
DOORS**

CONDITION

WARPAGE OF INTERIOR DOORS.

PERFORMANCE STANDARD

ALL WOOD DOORS GO THROUGH A PERIOD OF MOISTURE AND BALANCE DURING NEW CONSTRUCTION. DURING THE FIRST HEATING SEASON, THE DOOR WILL BE EXPOSED TO A RAPID DRYING CONDITION.

THIS WILL CAUSE THE DOOR TO WARP TEMPORARILY. THIS TEMPORARY WARPAGE IS NOT CONSIDERED A DEFECT AND IN MOST CASES THE DOOR WILL STRAIGHTEN OUT. HOWEVER, DOORS SHOULD NOT BECOME INOPERABLE AND WARPAGE OF THE DOOR AFTER THE FIRST HEATING SEASON SHOULD NOT EXCEED 1/4" MEASURED FROM CORNER TO CORNER DIAGONALLY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: KEEPING THE INTERIOR DOORS SHUT WILL HELP PREVENT THE DOORS FROM WARPING.

BUILDER'S RESPONSIBILITY: AT THE BUILDER'S SOLE OPTION, THE BUILDER WILL REPAIR OR REPLACE WARPED DOORS. IF REPLACEMENT IS REQUIRED, THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

**BI-FOLD
DOORS
COMING OFF
TRACKS**

CONDITION

BI-FOLD DOORS COME OFF TRACKS DURING NORMAL OPERATION.

PERFORMANCE STANDARD

BI-FOLD DOORS WILL SLIDE PROPERLY ON THEIR TRACKS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE CLEANING AND MAINTENANCE NECESSARY TO PRESERVE PROPER OPERATION IS THE RESPONSIBILITY OF THE HOME OWNER.

BUILDER'S RESPONSIBILITY: BI-FOLD DOORS NOT CAUSED BY THE HOME OWNER'S NEGLIGENCE OR DAMAGE WILL BE REPAIRED.

**BI-FOLD
DOORS IN
NEED OF
ADJUSTMENT**

CONDITION

BI-FOLD DOORS IN NEED OF ADJUSTMENT.

PERFORMANCE STANDARD

BI-FOLD DOORS WILL OPEN, CLOSE AND OPERATE SMOOTHLY. ADJUSTMENTS OF BI-FOLD DOORS IS COMMON AND IS A HOME OWNER MAINTENANCE ITEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: ADJUSTMENT OF THE BI-FOLD DOORS (AFTER THE CUSTOMER ORIENTATION) IS A HOME OWNER MAINTENANCE ITEM.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPLACE THE DOOR THAT IS WARPED BEYOND THE WARPING PERFORMANCE STANDARD. THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE BUT COLOR VARIATIONS ARE TO BE EXPECTED.

**GAPS
BETWEEN BI-
FOLD AND
DOOR STOP**

CONDITION

GAPS BETWEEN BI-FOLD AND DOOR STOP.

PERFORMANCE STANDARD

THE DOOR EDGE WILL BE WITHIN 3/8" OF PARALLEL TO THE DOOR STOP.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL ADJUST THE DOOR AS NECESSARY TO MEET THE PERFORMANCE STANDARD.

**DOOR RUBS
OR LATCH
DOES NOT
WORK**

CONDITION

DOOR RUBS OR LATCH DOES NOT WORK.

PERFORMANCE STANDARD

DOORS WILL OPERATE SMOOTHLY AND DOOR LATCHES WILL OPERATE CORRECTLY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE DOOR TO MEET THE PERFORMANCE STANDARD.

**DOOR DRAGS
ON CARPET**

CONDITION

DOOR DRAGS ON CARPET.

PERFORMANCE STANDARD

DOORS WILL NOT DRAG ON THE CARPET.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE DOOR TO MEET THE PERFORMANCE STANDARD.

**GAP
BETWEEN
DOOR STOP &
DOOR**

CONDITION

GAP BETWEEN DOOR STOP AND DOOR.

PERFORMANCE STANDARD

THE DOOR EDGE WILL BE WITHIN 3/8" OF PARALLEL TO THE DOOR STOP.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL ADJUST THE DOOR AS NECESSARY TO MEET THE PERFORMANCE STANDARD.

**SHRINKAGE
OF DOOR
PANEL
INSERTS**

CONDITION

SHRINKAGE OF DOOR PANEL INSERTS.

PERFORMANCE STANDARD

DOOR PANELS ARE NOT GLUED IN PLACE BUT ARE ALLOWED TO “MOVE” OR EXPAND AND CONTRACT WITH THE MOISTURE CONTENT. WHEN THIS MOVEMENT OCCURS, RAW WOOD EDGES MAY APPEAR. THIS MOVEMENT IS BEYOND THE BUILDER’S CONTROL AND IS NOT WARRANTED.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: NONE

BUILDER’S RESPONSIBILITY: NONE

**SPLITTING OF
DOOR PANELS**

CONDITION

SPLITTING OF DOOR PANELS.

PERFORMANCE STANDARD

SOME SPLITTING OF PANELS IS NORMAL AND SHOULD BE EXPECTED. SPLITS WHICH ALLOW THE ENTRANCE OF LIGHT WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: NONE

BUILDER’S RESPONSIBILITY: THE BUILDER WILL FILL THE SPLIT AND MATCH THE PAINT OR STAIN AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

**GARAGE DOOR
DOES NOT
OPERATE
PROPERLY
UNDER
NORMAL USE**

CONDITION

GARAGE DOOR DOES NOT OPERATE PROPERLY UNDER NORMAL USE.

PERFORMANCE STANDARD

GARAGE DOORS WILL OPERATE PROPERLY.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: NONE

BUILDER’S RESPONSIBILITY: THE BUILDER WILL CORRECT THE GARAGE DOORS AS REQUIRED UNLESS THE CAUSE IS DETERMINED TO BE THE RESULT OF THE HOME OWNER’S ACTIONS OR NEGLIGENCE.

NOTE: THE INSTALLATION OF GARAGE DOOR OPENERS MAY AFFECT THE OPERATION OF THE GARAGE DOORS, AND THIS IS NOT WARRANTED BY THE BUILDER.

**RAIN,SNOW
OR DRAFT
ENTERS
THROUGH
GARAGE**

CONDITION

RAIN, SNOW, OR DRAFT ENTERS THROUGH GARAGE DOOR.

PERFORMANCE STANDARD

GARAGE DOORS ARE NOT WEATHERPROOF AND AIR TIGHT AND SOME ENTRANCE OF RAIN, SNOW OR DRAFTS SHOULD BE EXPECTED. GARAGE DOORS WILL BE CORRECTED TO MEET THE MANUFACTURER’S SPECIFICATIONS.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: SWEEPING OUT ANY WATER OR SNOW ACCUMULATION UNDER THE GARAGE DOOR WILL KEEP THE GARAGE DOOR FROM FREEZING SHUT DURING THE WINTER MONTHS.

BUILDER’S RESPONSIBILITY: THE BUILDER WILL ADJUST THE GARAGE DOOR AS REQUIRED.

WINDOWS DO NOT OPERATE PROPERLY

CONDITION

WINDOWS DO NOT OPERATE PROPERLY.

PERFORMANCE STANDARD

WINDOWS WILL OPERATE WITH REASONABLE EASE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT WINDOWS AS REQUIRED.

WATER COLLECTING ON WINDOW SILL & FRAME

CONDITION

WATER COLLECTS IN AND LEAKS THROUGH ONTO WINDOW FRAME AND SILL.

PERFORMANCE STANDARD

DURING HEAVY RAIN, AND OR HEAVY RAIN ACCOMPANIED BY HIGH WINDS, IT IS POSSIBLE THAT RAIN WATER WILL COLLECT IN THE WINDOW TRACKS AT A RATE FASTER THAN THE "WEEP HOLES" CAN CARRY IT AWAY. IF WEEP HOLES ARE CHECKED AND CLEARED PERIODICALLY, SUCH OCCURANCES SHOULD BE MINIMAL. DAMAGE RESULTING FROM PLUGGED WEEP HOLES IS NOT A WARRANTED ITEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: KEEP WINDOWS CLOSED DURING RAINS, OR WHEN LEAVING THE HOME. IT MAY BE NECESSARY FOR THE HOME OWNER TO OCCASIONALLY CLEAR THE WINDOW TRACKS AND WEEP HOLES OF ANY DEBRIS TO ENSURE PROPER DRAINAGE. IN THE EVENT THAT WATER RUNS INTO THE TRACKS AND/OR ONTO THE WINDOW SILL, IT IS THE HOME OWNER'S RESPONSIBILITY TO WIPE UP ANY WATER TO PREVENT DAMAGE TO THE WOOD WINDOW SILL.

BUILDER'S RESPONSIBILITY: UNLESS DIRECTLY ATTRIBUTED TO FAULTY INSTALLATION OF THE WINDOW, NO CORRECTIVE ACTION IS REQUIRED BY THE BUILDER.

DRAFT AROUND WINDOWS & PORCH DOORS

CONDITION

DRAFTS AROUND WINDOWS AND PORCH DOORS.

PERFORMANCE STANDARD

SOME DRAFT SHOULD BE EXPECTED AROUND DOORS AND WINDOWS ESPECIALLY DURING HIGH WINDS. PROPER WEATHER-STRIPPING AND INSULATING AROUND THESE AREAS CAN MINIMIZE AIR FLOW. DEFECTIVE WEATHER-STRIPPING WILL BE ADJUSTED OR REPLACED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: UNDER CERTAIN TEMPERATURES AND WIND CONDITIONS, SOME INFILTRATION WILL OCCUR AND IT MAY BE NECESSARY FOR THE HOMEOWNER TO HAVE STORM DOORS AND WINDOWS INSTALLED TO PROVIDE SATISFACTORY SOLUTIONS IN THESE HIGH WIND AREAS.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL ADJUST OR CORRECT POORLY FITTED DOORS, WINDOWS AND POORLY FITTED WEATHER-STRIPPING.

**STRESS
CRACKS IN
GLASS**

CONDITION

STRESS CRACKS IN GLASS.

PERFORMANCE STANDARD

GLASS SHOULD NOT CRACK DURING THE FIRST YEAR WARRANTY PERIOD. GLASS THAT IS CRACKED DUE TO HOME OWNER'S NEGLIGENCE WILL NOT BE COVERED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPLACE THE CRACKED PIECE OF GLASS.

**FROST OR
MIST ON THE
WINDOWS**

CONDITION

CONDENSATION OR FROSTING ON WINDOWS.

PERFORMANCE STANDARD

WINDOWS WILL COLLECT CONDENSATION ON THE INTERIOR SURFACES WHEN THERE ARE EXTREME TEMPERATURE DIFFERENCES AND HIGH HUMIDITY LEVELS IN THE HOME. CONDENSATION IS USUALLY CREATED BY THE HOMEOWNER AND IS AN INDICATION OF EITHER TOO MUCH MOISTURE IN THE ROOM, OR POOR CIRCULATION OF THE MOISTURE THAT IS PRESENT IN THE ROOM. DAMAGE RESULTING FROM CONDENSATION IS NOT A WARRANTED ITEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: DUE TO THE TIGHT CONSTRUCTION OF NEW HOMES, MOISTURE CAN BE TRAPPED IN MANY WAYS. THIS MOISTURE CAN ALSO BE CREATED BY THE USE OF KITCHEN APPLIANCES, LAUNDRY FACILITIES AND BATHROOM USAGE. THERE ARE SEVERAL STEPS THAT CAN BE TAKEN TO ASSIST IN REDUCING AND CONTROLLING MOISTURE:

1. IF THE WOOD AROUND THE WINDOWS GETS WET OR DAMP, YOU NEED TO DRY THIS WOOD OFF. **REMEMBER:** DAMAGE RESULTING FROM CONDENSATION IS NOT WARRANTABLE.
2. TURN OFF OR REDUCE THE SETTING OF THE HUMIDIFIER, IF APPLICABLE.
3. OPERATE EXHAUST FANS IN AREAS OF HIGH MOISTURE INPUT SUCH AS LAUNDRY ROOMS, KITCHENS AND BATHS.
4. VENTILATE THE HOUSE BRIEFLY ONCE A DAY.
5. USE A DEHUMIDIFIER TO REMOVE MOISTURE.
6. INCREASE THE CIRCULATION OF THE AIR IN THE HOUSE BY TURNING THE FAN SWITCH TO THE ON POSITION ON THE THERMOSTAT.
7. REDUCE THE MOISTURE INPUT INTO THE HOME (SHOWERING, COOKING, ETC.).
8. OPEN WINDOW CURTAINS AND SHADES DURING THE DAY.

BUILDER'S RESPONSIBILITY: UNLESS DIRECTLY ATTRIBUTED TO FAULTY INSTALLATION, WINDOW CONDENSATION IS A RESULT OF CONDITIONS BEYOND THE BUILDER'S CONTROL. NO CORRECTIVE ACTION IS REQUIRED BY THE BUILDER.

INTERIOR TRIM & CAULKING

SEPARATION OF INTERIOR TRIM (MITER'S)

CONDITION

SEPARATION OF INTERIOR TRIM (MITER'S).

PERFORMANCE STANDARD

SEPARATIONS IN MOLDINGS OR SEPARATION BETWEEN MOLDINGS AND ADJACENT SURFACES (INCLUDING CASEMENT, BASES, ETC.) SHOULD BE EXPECTED WITHIN CERTAIN TOLERANCES. SEPARATIONS IN EXCESS OF 1/8" WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SEPARATION BY CAULKING OR OTHER METHODS. IF REPLACEMENT IS REQUIRED, THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

COLOR VARIATIONS IN WOOD TRIM

CONDITION

COLOR VARIATIONS IN WOOD TRIM.

PERFORMANCE STANDARD

ALL WOOD PRODUCTS HAVE VARIATIONS IN GRAIN AND COLOR. THESE VARIATIONS CANNOT BE CONTROLLED AND ARE NOT WARRANTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE

CRACKING OR SPLITTING OF INTERIOR WOOD TRIM

CONDITION

CRACKING OR SPLITTING OF INTERIOR WOOD TRIM.

PERFORMANCE STANDARD

SOME SPLITTING OF WOOD IS NORMAL AND SHOULD BE EXPECTED; CRACKS EXCEEDING 1/8" WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS OR SPLITS EXCEEDING THE PERFORMANCE STANDARD BY FILLING THE CRACK/SPLIT AND MATCHING THE PAINT OR STAIN AS CLOSELY AS POSSIBLE OR BY OTHER METHODS. IF REPLACEMENT IS REQUIRED, THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

**LOOSE
CAULKING AT
-PLUMBING
-DOORS
-VINYL FLOORS**

CONDITION

LOOSE CAULKING AROUND PLUMBING FIXTURES, EXTERIOR DOORS AND VINYL FLOORING.

PERFORMANCE STANDARD

CAULKING SHALL BE INSTALLED PROPERLY AROUND TUBS/SHOWERS, EXTERIOR DOORS AND VINYL FLOORING (WHERE APPLICABLE).

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: FROM TIME TO TIME, IT MAY BE NECESSARY FOR THE HOME OWNER TO RE-CAULK AREAS THAT COME LOOSE DUE TO USE, DAMAGE OR CHANGES IN HUMIDITY OR TEMPERATURE. IT IS IMPORTANT THAT THESE AREAS BE MAINTAINED TO AVOID ANY DAMAGE TO UNDERLAYMENT, WOOD TRIM, DRYWALL OR FLOORING.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL BE RESPONSIBLE FOR PROPERLY CAULKING APPLICABLE AREAS DURING THE CONSTRUCTION PROCESS. HOWEVER, ROUTINE RE-CAULKING IS A HOME OWNER MAINTENANCE ITEM AND NOT A WARRANTED ITEM.

FLOOR COVERING

RIDGES OR DEPRESSIONS IN VINYL FLOORING

CONDITION

RIDGING OR DEPRESSIONS APPEAR IN RESILIENT OR VINYL FLOORING DUE TO SUBFLOOR IRREGULARITIES.

PERFORMANCE STANDARD

RIDGES OR DEPRESSIONS EXCEEDING 1/4" WITHIN A 32" AREA MEASURING PERPENDICULAR TO THE RIDGE OR DEPRESSION WILL BE REPAIRED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE FLOOR BY SHIMMING THE FLOOR, PULLING THE SUBFLOOR DOWN, OR OTHER METHODS REQUIRED TO MEET THE PERFORMANCE STANDARD.

DENTING OF RESILIENT OR VINYL FLOORING

CONDITION

DENTING OF RESILIENT OR VINYL FLOORING.

PERFORMANCE STANDARD

THE NATURE OF RESILIENT OR VINYL FLOORING MAKES IT POSSIBLE TO DEFORM THE SURFACE PERMANENTLY WHEN SUBJECT TO HIGH LOADS OF PRESSURE EXERTED BY FURNITURE, HIGH HEELS OR OTHER SIMILAR HIGH PRESSURE LOADS. BECAUSE OF THIS AND THE WEAR AND TEAR CAUSED BY NORMAL USE OF RESILIENT OR VINYL FLOORING, DENTING OF RESILIENT OR VINYL FLOORING IS NOT WARRANTABLE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO INSURE PROPER DURABILITY OF RESILIENT OR VINYL FLOORING, PROPER FLOOR PROTECTORS SHOULD BE INSTALLED ON ALL FURNITURE AND CHAIRS. WEARING HIGH HEEL SHOES ON RESILIENT OR VINYL FLOORING IS NOT RECOMMENDED AND SHOULD BE AVOIDED.

BUILDER'S RESPONSIBILITY: NONE

NAILS POPPING THROUGH VINYL OR RESILIENT FLOORING

CONDITION

NAILS POPPING THROUGH RESILIENT OR VINYL FLOORING.

PERFORMANCE STANDARD

NAIL POPS WHICH HAVE BROKEN THROUGH THE FLOOR COVERING WILL BE REPAIRED

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE NAIL POPS AND THE COVERING IN THE DAMAGED AREA. ALL RESILIENT FLOORING IS SUBJECT TO NORMAL MANUFACTURING TOLERANCES AND MOST PARTICULARLY TO DYE LOT VARIATIONS AFFECTING COLOR, TEXTURE AND PATTERN. FROM TIME TO TIME, PATTERNS ARE TAKEN OFF THE MARKET. THEREFORE, THE BUILDER WILL NOT BE RESPONSIBLE FOR DISCONTINUED PATTERNS OR COLOR VARIATIONS IN THE FLOOR COVERINGS.

**STAINING OF
RESILIENT OR
VINYL
FLOORING**

CONDITION

STAINING OF RESILIENT OR VINYL FLOORING.

PERFORMANCE STANDARD

RESILIENT OR VINYL FLOORING CAN STAIN DUE TO VARIOUS REASONS. RESILIENT OR VINYL FLOORING SHOULD NOT STAIN DURING THE NORMAL WARRANTY PERIOD UNLESS CAUSED BY THE HOME OWNER'S NEGLIGENCE. TOPICAL STAINS ARE NOT WARRANTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: HERE ARE A FEW SUGGESTIONS THAT CAN BE USED TO PREVENT ANY STAINING OF YOUR NEW VINYL FLOOR COVERING:

- 1) DIRECT SUNLIGHT WILL IN FACT DISCOLOR VINYL. WE SUGGEST USING WINDOW TREATMENTS TO REFRACT SUNLIGHT. THIS ALSO INCLUDES SKYLIGHTS.
- 2) USE OF RUBBER BACK MATS WILL DISCOLOR YOUR FLOOR. WE RECOMMEND NON-RUBBER BACK RUGS.
- 3) DECK STAINS AND ALL OIL BASED PAINTS WILL ALSO DISCOLOR FLOORS. WITH DECK STAINS AND STAINS IN GENERAL, WALKING FROM STAINED SURFACES ONTO VINYL WILL CAUSE TRACKING OF STAIN TO THE VINYL FLOOR. IT IS BEST TO HAVE SOME SORT OF MAT TO WIPE YOUR SHOES BEFORE YOU WALK ON THE FLOOR.
- 4) ASPHALT DRIVEWAYS AND SEALERS WILL ALSO STAIN VINYL. IT IS BEST TO REMOVE SHOES FIRST OR USE RUGS TO WIPE YOUR FEET.
- 5) CLEANING SOLVENTS - YOU MUST BE CAREFUL TO USE ONLY THE MANUFACTURER'S SUGGESTED CLEANING PRODUCTS WHEN CLEANING YOUR FLOOR. ALSO, WHEN CLEANING APPLIANCES, MAKE SURE TO PROTECT YOUR FLOOR FROM SOLVENTS DRIPPING ON TO YOUR FLOOR AS THESE MAY DISCOLOR YOUR VINYL.
- 6) EXCESSIVE HEAT MAY BURN OR DISCOLOR YOUR VINYL. (EXCESSIVE HEAT IS CONSIDERED TO BE OVER 125 DEGREES F.)
- 7) LAWN FERTILIZERS MAY DISCOLOR VINYL FLOORS, BOTH THE LIQUID AND GRANULAR TYPES. IT IS BEST TO REMOVE FOOTWEAR BEFORE WALKING ON VINYL FLOORS.

BUILDER'S RESPONSIBILITY: IF THE CAUSE OF THE STAINING IS NOT DUE TO THE HOME OWNER'S NEGLIGENCE, THE BUILDER WILL CORRECT THE AFFECTED AREA. THE BUILDER IS NOT RESPONSIBLE FOR DISCONTINUED PATTERNS OR COLORS, OR FOR VARIATIONS IN COLOR.

**RESILIENT OR
VINYL
FLOORING
BUBBLES OR
UNGLUES**

CONDITION

RESILIENT OR VINYL FLOORING LIFTS, BUBBLES OR BECOMES UNGLUED AT THE SEAMS.

PERFORMANCE STANDARD

RESILIENT OR VINYL FLOORING SHOULD NOT LOOSEN DURING THE NORMAL FIRST YEAR WARRANTY PERIOD UNLESS CAUSED BY THE HOME OWNER'S NEGLIGENCE OR EXCESS USE OF WATER.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOMEOWNER SHOULD MAINTAIN AND REPAIR THE VINYL EDGES THAT MEET CABINETS, SHOWER BASES, TUBS OR ANY OTHER AREAS WHERE WATER MAY BE ALLOWED TO PENETRATE.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL SECURE THE RESILIENT OR VINYL MATERIAL.

**DAMAGED
VINYL
FLOORING OR
CARPETING**

CONDITION

DAMAGED VINYL FLOORING OR CARPETING.

PERFORMANCE STANDARD

DAMAGE THAT OCCURS DUE TO THE NEGLIGENCE OF THE BUILDER WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: IF THE CAUSE OF THE DAMAGE IS NOT DUE TO THE HOME OWNER'S NEGLIGENCE, THE BUILDER WILL REPAIR THE DAMAGED AREA. DUE TO NORMAL MANUFACTURING TOLERANCES AND MOST PARTICULARLY TO DYE LOT VARIATIONS AFFECTING COLOR, TEXTURE AND PATTERNS, THE BUILDER WILL NOT BE RESPONSIBLE FOR THESE VARIATIONS.

**GAPS IN
CARPET
SEAMS**

CONDITION

GAPS IN CARPET SEAMS.

PERFORMANCE STANDARD

CARPET SEAMS WILL SHOW BUT VISIBLE OPENINGS ARE NOT ACCEPTABLE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE AFFECTED AREA SO OPENINGS ARE NOT VISIBLE.

**CARPET
STRETCHES
OR LOOSENS**

CONDITION

CARPET STRETCHES OR LOOSENS.

PERFORMANCE STANDARD

WALL TO WALL CARPETING INSTALLED AS THE PRIMARY FLOOR COVERING WILL NOT COME UP, LOOSEN, OR SEPARATE FROM THE POINT OF ATTACHMENTS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: WHEN MOVING ANY FURNITURE IN THE HOME, DO NOT DRAG THE PIECE OF FURNITURE ACROSS THE CARPETING. THIS CAN CAUSE THE CARPET TO LOOSEN.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL RESTRETCH OR SECURE THE CARPETING AS NECESSARY.

**MATTING OF
CARPET**

CONDITION

MATTING OF CARPET.

PERFORMANCE STANDARD

PLEASE SEE THE MANUFACTURER SPECIFICATIONS FOR FURTHER DETAILS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO INSURE A PROPER APPEARANCE OF YOUR CARPET, THE HOMEOWNER SHOULD VACUUM AT LEAST EVERY OTHER DAY WITH A GOOD QUALITY VACUUM. TRY TO PAY MORE ATTENTION TO THE TRAFFIC AREAS OF YOUR HOME. IT IS IMPORTANT TO MAKE AT LEAST FOUR PASSES IN EACH AREA WITH YOUR VACUUM IN ORDER TO PREVENT DUST AND DIRT PARTICLES FROM WORKING INTO THE CARPET PILE. ALSO, MOVE YOUR FURNITURE TO DIFFERENT LOCATIONS IN THE ROOM PERIODICALLY.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE CARPET TO MEET THE MANUFACTURER'S SPECIFICATIONS.

**STAINING OR
SHADING OF
CARPET**

CONDITION

STAINING OR SHADING OF CARPET.

PERFORMANCE STANDARD

NONE

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NO CARPET IS TOTALLY STAIN PROOF. SPILLS AND ACCIDENTS SHOULD BE REMOVED UPON OCCURRENCE.

BUILDER'S RESPONSIBILITY: NONE

**CRACKING OR
SEPARATING
BETWEEN
HARDWOOD
FLOOR
BOARDS**

CONDITION

CRACKING OR SEPARATING BETWEEN HARDWOOD FLOOR BOARDS.

PERFORMANCE STANDARD

CRACKS IN EXCESS OF 1/8" IN WIDTH WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO PROPERLY CARE FOR YOUR HARDWOOD FLOORS YOU WILL NEED TO DO THE FOLLOWING:

1. KEEP THE FLOOR FREE FROM WATER AND ANY OTHER SUBSTANCES THAT WILL DAMAGE THE FINISH OF THE FLOOR.
2. CONTROL THE HUMIDITY IN YOUR HOME. THE HUMIDITY LEVEL IN YOUR HOME SHOULD BE MAINTAINED BETWEEN 30-50 PERCENT. IF THE HUMIDITY FALLS BELOW THIS LEVEL, THE FLOOR BOARDS MAY SHRINK THUS CAUSING GAPS BETWEEN THE STRIPS OF THE FLOORING. THIS CONDITION IS VERY COMMON DURING THE DRY MONTHS OF WINTER AND A HUMIDIFIER WILL HELP CONTROL THIS SHRINKAGE.

THE REVERSE CONDITION OCCURS DURING THE SUMMER MONTHS WHEN THERE IS TOO MUCH HUMIDITY IN THE HOME. DURING THIS TIME, THE FLOORING MAY SWELL TO THE POINT WHERE IT WILL BUCKLE AND LIFT OFF THE SUBFLOOR. A DEHUMIDIFIER MAY BE NEEDED TO CONTROL THIS. DAMAGE THAT OCCURS DUE TO A POORLY MAINTAINED FLOOR WILL NOT BE WARRANTED BY THE BUILDER.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE CRACKS IN EXCESS OF THE PERFORMANCE STANDARD BY FILLING OR REPLACING THE BOARDS AT THE SOLE OPTION OF THE BUILDER. THE BUILDER WILL MATCH THE GRAIN AND STAIN AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

CERAMIC

**CERAMIC TILE
CRACKS OR
BECOMES
LOOSE**

CONDITION

CERAMIC TILE CRACKS OR BECOMES LOOSE.

PERFORMANCE STANDARD

CERAMIC TILE WILL NOT CRACK OR BECOME LOOSE. TILE THAT IS CHIPPED IS NOT WARRANTABLE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPLACE ONLY CRACKED TILE AND SECURE ANY TILES THAT ARE LOOSE. THE BUILDER WILL NOT REPLACE ANY TILES THAT WERE DAMAGED BY THE HOME OWNER'S ACTION OR NEGLIGENCE. THE BUILDER IS NOT RESPONSIBLE FOR DISCONTINUED PATTERNS OR COLOR VARIATIONS IN CERAMIC TILE.

**CRACKING OF
GROUT
BETWEEN
TILES**

CONDITION

CRACKING OF GROUT BETWEEN TILE JOINTS OR AT JUNCTIONS WITH OTHER MATERIALS SUCH AS A BATHTUB.

PERFORMANCE STANDARD

CRACKS THAT DEVELOP IN THE GROUTING OF THE CERAMIC TILE JOINTS SHOULD BE EXPECTED DUE TO NORMAL SHRINKAGE CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: CERAMIC TILE SHOULD BE REGROUTED WHEN NECESSARY. SHOWER AREAS WILL REQUIRE IMMEDIATE ATTENTION TO PREVENT ANY WATER FROM GETTING IN BEHIND THE TILE. IT WILL BE THE BUILDER'S RESPONSIBILITY TO REPAIR GROUT CRACKS ONE TIME DURING THE FIRST YEAR WARRANTY PERIOD. ROUTINE REGROUTING OF CRACKS IS A MAINTENANCE RESPONSIBILITY OF THE HOMEOWNER FOR THE LIFE OF THE HOME.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR GROUT CRACKS ONE TIME ONLY. THE BUILDER IS NOT RESPONSIBLE FOR DISCONTINUED GROUT OR GROUT COLOR VARIATIONS.

**DISCOLORATION
OF CERAMIC
TILE OR GROUT**

CONDITION

DISCOLORATION OF CERAMIC TILE OR GROUT.

PERFORMANCE STANDARD

DUE TO HARD WATER DEPOSITS, SOAP SCUM AND BODY OIL BUILD UPS, CERAMIC TILE AND GROUT WILL REQUIRE ROUTINE CLEANING.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: USUALLY WIPING TILED FLOORS OR WALLS WITH A DAMP SPONGE IS ALL THAT IS NECESSARY TO MAINTAIN THEIR LUSTER. WHERE MODERATE STAINING OCCURS, A MILD SOLUTION OF HOT WATER AND ALL PURPOSE LIQUID CLEANER OR SOAPLESS DETERGENT MAY BE NEEDED.

KEEPING SHOWERS CLEAN REQUIRES A SLIGHTLY DIFFERENT TECHNIQUE. WEEKLY CLEANING IS RECOMMENDED. SEVERAL ALL-PURPOSE CLEANERS ARE EXCELLENT FOR REMOVING ROUTINE BUILD-UPS FROM SHOWER STALLS. HARD WATER DEPOSITS CAN BE REMOVED WITH A MILD SOLUTION OF WHITE VINEGAR AND WATER. THE BEST WAY TO PREVENT BUILD-UP OF THESE DEPOSITS OR SOAP SCUM IS TO WIPE DOWN THE WALLS AFTER EACH USE.

BUILDER'S RESPONSIBILITY: NONE

COUNTERTOPS & CABINETS

CHIPS OR SCRATCHES IN COUNTERTOPS OR CABINETS

CONDITION

CHIPS, CRACKS, OR SCRATCHES IN COUNTERTOPS OR CABINETS.

PERFORMANCE STANDARD

CRACKS, CHIPS OR SCRATCHES, INCLUDING PORCELAIN AND FIBERGLASS FIXTURES, NOT REPORTED TO THE BUILDER BEFORE OCCUPANCY BY THE HOMEOWNER WILL NOT BE COVERED UNDER THIS WARRANTY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO PROTECT YOUR COUNTERTOPS FROM DAMAGE, PLEASE REMEMBER THE FOLLOWING:

- 1) AVOID PUTTING HOT POTS, PANS OR IRONS ON THEM.
- 2) NEVER CUT DIRECTLY ON FORMICA TOPS AS KNIVES WILL NICK THE SURFACE.
- 3) DO NOT CLEAN COUNTERTOPS WITH HARSH ABRASIVES.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR ONLY THE CHIPS, CRACKS OR SCRATCHES THAT WERE NOTED ON THE ORIGINAL ACCEPTANCE OF CONSTRUCTION FORM.

COUNTERTOP JOINTS DE- LAMINATE

CONDITION

COUNTERTOP JOINTS DE-LAMINATE.

PERFORMANCE STANDARD

COUNTERTOPS WILL NOT DELAMINATE DURING THE FIRST YEAR WARRANTY PERIOD.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE COUNTERTOP.

COUNTERTOP SEPARATES FROM WALL OR FROM BACKSPLASH

CONDITION

COUNTERTOP SEPARATES FROM WALL OR BACKSPLASH.

PERFORMANCE STANDARD

CRACKING AND SEPARATION OF COUNTERTOP JOINTS IS COMMON AND IS A HOME OWNER'S RESPONSIBILITY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: COUNTERTOPS SHOULD BE RECAULKED WHEN NECESSARY. IT WILL BE THE BUILDER'S RESPONSIBILITY TO REPAIR CRACKED CAULK ONE TIME DURING THE WARRANTY PERIOD. ROUTINE RECAULKING IS A HOMEOWNER MAINTENANCE ITEM.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR CAULKING ONE TIME ONLY DURING THE FIRST YEAR WARRANTY PERIOD.

**COUNTERTOP
IS NOT LEVEL**

CONDITION

COUNTERTOP IS NOT LEVEL.

PERFORMANCE STANDARD

COUNTERTOPS WILL BE NO MORE THAN 1/4" IN 12 FEET OUT OF PARALLEL WITH THE FLOOR.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL MAKE THE NECESSARY ADJUSTMENTS BY SHIMMING AND LEVELING THE COUNTERTOP TO MEET THE ACCEPTABLE STANDARD.

**CABINET
SEPARATES
FROM WALL
OR CEILING**

CONDITION

CABINET SEPARATES FROM WALL OR CEILING.

PERFORMANCE STANDARD

SOME SEPARATION IS NORMAL AND SHOULD BE EXPECTED, SEPARATIONS IN EXCESS OF 1/4" WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT SEPARATIONS THAT EXCEED 1/4".

**CABINET DOOR
NEEDS
ADJUSTMENT**

CONDITION

CABINET DOOR IS OUT OF ALIGNMENT OR NEEDS ADJUSTMENT.

PERFORMANCE STANDARD

CABINET DOORS THAT ARE WARPED MORE THAN 1/4" MEASURED FROM CORNER TO CORNER DIAGONALLY WILL BE REPLACED. ADJUSTMENTS OF CABINET DOORS IS COMMON AND IS A HOMEOWNER MAINTENANCE ITEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO ADJUST YOUR CABINET DOORS PLEASE DO THE FOLLOWING:

- 1) LOOSEN THE 2 HINGE SCREWS ON THE DOOR. DO NOT REMOVE SCREWS.
- 2) LOOSENING THE SCREWS WILL PROVIDE ABOUT A 3/8" VERTICAL AND HORIZONTAL MOVEMENT IN THE DOOR.
- 3) WITH THE SCREWS LOOSE, SQUARE THE DOOR AND TIGHTEN THE SCREWS.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPLACE THE DOOR THAT IS WARPED BEYOND THE PERFORMANCE STANDARD. THE BUILDER WILL MATCH THE GRAIN AND STAIN (OR PAINT) AS CLOSELY AS POSSIBLE, BUT COLOR VARIATIONS ARE TO BE EXPECTED.

**CABINET OR
LAZY-SUSAN
SHELVING IS
WARPED**

CONDITION

CABINET OR LAZY-SUSAN SHELVING IS WARPED.

PERFORMANCE STANDARD

CABINET SHELVING THAT IS WARPED MORE THAN 1/4" MEASURED FROM CORNER TO CORNER DIAGONALLY, WILL BE REPLACED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: SHELVING WAS NOT DESIGNED TO BE OVERLOADED WITH NUMEROUS CANNED GOODS OR A LARGE NUMBER OF OTHER HEAVY ITEMS. IN ADDITION, IT IS IMPORTANT THAT THE ITEMS BE BALANCED TO PROVIDE FOR EASIER USE. IT IS THE HOME OWNER'S RESPONSIBILITY TO KEEP FROM OVERLOADING THE SHELVES.

BUILDER'S RESPONSIBILITY: SHELVING WARPAGE NOT CAUSED BY HOME OWNER'S MISHANDLING OR DAMAGE WILL BE REPLACE BY THE BUILDER.

PAINTING & STAINING

**PEELING OR
DETERIOR-
ATION OF
VARNISH
(INTERIOR)**

CONDITION

PEELING OR DETERIORATION OF VARNISH ON INTERIOR WOODWORK.

PERFORMANCE STANDARD

FINISHES ON INTERIOR WOODWORK WILL NOT DETERIORATE DURING THE FIRST YEAR OF THE WARRANTY PERIOD. VARNISH THAT IS DAMAGED FROM THE RESULT OF WATER WILL NOT BE COVERED UNDER THIS WARRANTY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: WOODWORK THAT BECOMES SOILED AND DIRTY CAN BE CLEANED WITH A MILD LIQUID SOAP AND DAMP CLOTH. ONCE CLEAN, EXCESS MOISTURE SHOULD BE REMOVED WITH A DRY CLOTH.

BUILDER'S RESPONSIBILITY: DURING THE WARRANTY PERIOD, THE BUILDER WILL PREPARE AND REFINISH THE AFFECTED AREA. DUE TO THE DIFFERENT DYE LOT COLORS IN STAINS, COLOR AND FINISH VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR OR SURFACE VARIATIONS.

**COLOR
VARIATIONS
OF STAINED
WOODWORK**

CONDITION

COLOR VARIATIONS OF STAINED WOODWORK.

PERFORMANCE STANDARD

ALL WOOD PRODUCTS HAVE VARIATIONS IN GRAIN AND COLOR. THESE VARIATIONS CANNOT BE CONTROLLED BY THE BUILDER AND ARE NOT WARRANTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE

**INTERIOR
PAINT DOES
NOT COVER
UNDERLYING
SURFACE**

CONDITION

INTERIOR PAINT DOES NOT "COVER" THE UNDERLYING SURFACE.

PERFORMANCE STANDARD

THE SURFACE BEING PAINTED WILL NOT SHOW THROUGH THE NEW PAINT WHEN VIEWED FROM A DISTANCE OF 6 FEET UNDER NORMAL LIGHTING CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL TOUCH UP THE PAINT AS NECESSARY TO MEET THE PERFORMANCE STANDARD. DUE TO THE DIFFERENT DYE LOT COLORS IN PAINT, COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**INTERIOR
WALLS SHOW
PAINT
FLASHING DUE
TO TOUCH-UPS**

CONDITION

**INTERIOR WALL SURFACES SHOW PAINT FLASHING (ROLLER MARKS/
TEXTURE DIFFERENCES) DUE TO TOUCH-UPS AND/OR CORRECTIONS.**

PERFORMANCE STANDARD

ALL PAINT TOUCH-UPS AND CORRECTIONS WILL SHOW PAINT FLASHING DUE TO TEXTURE DIFFERENCES. PAINT FLASHING WILL NOT BE READILY VISIBLE ON WALLS WHEN VIEWED DIRECTLY AT WALLS (NOT AT ANGLES) FROM A DISTANCE OF 6 FEET UNDER NORMAL LIGHTING CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL TOUCH UP THE AFFECTED AREA TO MEET THE PERFORMANCE STANDARD.

**INTERIOR
SURFACES
ARE PAINT
SPATTERED**

CONDITION

INTERIOR SURFACES ARE PAINT SPATTERED.

PERFORMANCE STANDARD

PAINT SPATTERS WILL NOT BE READILY VISIBLE ON WALLS, WOODWORK, FLOORS OR OTHER INTERIOR SURFACES WHEN VIEWED FROM A DISTANCE OF 6 FEET UNDER NORMAL LIGHTING CONDITIONS.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: MOST PAINT SPATTER CAN BE REMOVED BY WIPING THE AFFECTED AREAS WITH A DAMP CLOTH.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REMOVE PAINT SPATTERS TO MEET THE PERFORMANCE STANDARD.

CONDITION

PEELING OR FADING OF EXTERIOR PAINT OR STAIN.

PERFORMANCE STANDARD

EXTERIOR PAINT OR STAIN SHOULD NOT PEEL DURING THE FIRST YEAR WARRANTY PERIOD. FADING OF PAINT OR STAIN IS NORMAL AND IS NOT COVERED UNDER THIS WARRANTY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO MAINTAIN THE LONGEVITY OF WOOD SIDING AND TRIM, IT MAY BE NECESSARY TO REPAINT EVERY 3-5 YEARS.

BUILDER'S RESPONSIBILITY: DURING THE FIRST WARRANTY PERIOD, THE BUILDER WILL PREPARE AND TOUCH-UP THE AFFECTED AREAS BY MATCHING THE STAIN OR PAINT AS CLOSELY AS POSSIBLE. DUE TO THE DIFFERENT DYE LOT COLORS IN PAINT AND STAIN, COLOR VARIATIONS SHOULD BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR COLOR VARIATIONS.

**PEELING OR
FADING OF
EXTERIOR
PAINT OR
STAIN**

**VISUAL
BLEMISHES;
NAIL POPS,
CRACKS, ETC.**

DRYWALL

CONDITION

VISUAL BLEMISHES CAUSED BY NORMAL SHRINKAGE OF THE HOME SUCH AS NAIL POPS, CRACKS, CRACKED CORNER BEADS, ETC.

PERFORMANCE STANDARD

ANY OF THE ABOVE BLEMISHES WHICH CAN BE READILY IDENTIFIED BY A VISUAL INSPECTION WITHOUT RESORTING TO LIGHT PLACEMENT, WILL BE REPAIRED BY THE BUILDER ONE TIME ONLY DURING THE FIRST YEAR WARRANTY PERIOD. DUE TO THE SHRINKAGE PROCESS OF A NEW HOME, CRACKS IN THE DRYWALL ARE NORMAL AND ARE A HOMEOWNER MAINTENANCE ITEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: WITH THE USE OF SPACKLING COMPOUND AND SANDPAPER, MINOR CRACKS AND NAIL POPS CAN BE EASILY REPAIRED.

BUILDER'S RESPONSIBILITY: DRYWALL REPAIRS WILL BE MADE NO MORE THAN ONE TIME DURING THE FIRST WARRANTY PERIOD. TO ALLOW THE HOME TO STABILIZE ITSELF, IT IS RECOMMENDED THAT DRYWALL REPAIRS ARE CORRECTED AT THE END OF THE WARRANTY PERIOD, USUALLY DURING THE ELEVENTH MONTH OF THE WARRANTY.

PLEASE BE AWARE THAT THE BUILDER WILL REFINISH ONLY THE REPAIRED AREA. THE BUILDER WILL TRY TO MATCH THE REPAIR TEXTURE AND COLOR AS CLOSELY AS POSSIBLE, BUT THE EXACT MATCH IS IMPOSSIBLE TO ACHIEVE, AND THE BUILDER WILL NOT BE RESPONSIBLE FOR THESE VARIATIONS.

AN IMPORTANT DETAIL TO NOTE REGARDING WALL COLOR CHANGES AND WALLPAPERED AREAS: IF THE HOMEOWNER HAS PAINTED OR REPAINTED THE WALLS, THE BUILDER WILL ONLY REPAIR THE AREA, NOT PAINT IT. IN WALLPAPERED AREAS, IF REQUESTED, THE BUILDER WILL REPAIR THE DRYWALL BUT WILL NOT REPAIR OR REPLACE THE WALLPAPER. IT IS RECOMMENDED THAT THE HOMEOWNER WAIT TILL AFTER THEIR FIRST YEAR TO REPAINT OR WALLPAPER.

HEATING & COOLING

INSUFFICIENT HEATING

CONDITION

INSUFFICIENT HEATING.

PERFORMANCE STANDARD

A TEMPERATURE OF 72 DEGREES FAHRENHEIT (MEASURED 5 FEET ABOVE THE CENTER OF THE FLOOR) SHOULD BE MAINTAINED BY THE HEATING SYSTEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IT IS THE RESPONSIBILITY OF THE HOMEOWNER TO BALANCE THE HEATING SYSTEM BY ADJUSTING THE DAMPERS AND REGISTERS AS NEEDED. HERE ARE SOME HELPFUL TIPS FOR YOUR HEATING SYSTEM:

- 1) SAVE ON ENERGY COSTS BY SETTING TEMPERATURES AT 68 DEGREES FAHRENHEIT FOR THE WINTER. CONSTANT RESETTING WASTES ENERGY.
- 2) CLOSE VENTS/REGISTERS IN ROOMS NOT IN USE; ALSO CLOSE DOORS TO THESE ROOMS.
- 3) SINCE HOT AIR RISES AND COLD AIR STAYS CLOSE TO LOW POINTS, IN THE COLD MONTHS, YOU SHOULD CLOSE SOME 2ND FLOOR REGISTERS AND MAKE SURE THAT OTHER REGISTERS ARE NOT BLOCKED BY FURNITURE OR OTHER OBJECTS.
- 4) TO ELIMINATE HOT AND COLD SPOTS IN YOUR HOME, TURN THE FAN SWITCH ON THE THERMOSTAT TO THE ON POSITION.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SYSTEM SO THAT IT WILL MEET THE PERFORMANCE STANDARD.

INSUFFICIENT COOLING

CONDITION

INSUFFICIENT COOLING.

PERFORMANCE STANDARD

A TEMPERATURE OF 78 DEGREES FAHRENHEIT (MEASURED 5 FEET ABOVE THE CENTER OF THE FLOOR) SHOULD BE MAINTAINED BY THE COOLING SYSTEM.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IT IS THE RESPONSIBILITY OF THE HOMEOWNER TO BALANCE THE COOLING SYSTEM BY ADJUSTING THE DAMPERS AND REGISTERS AS NEEDED.

HERE ARE SOME HELPFUL TIPS FOR YOUR COOLING SYSTEM:

- 1) SAVE ON ENERGY COSTS BY SETTING TEMPERATURES AT 78 DEGREES FAHRENHEIT FOR THE SUMMER. CONSTANT RESETTING WASTES ENERGY.
- 2) CLOSE VENTS/REGISTERS IN ROOMS NOT IN USE; ALSO CLOSE DOORS TO THESE ROOMS.
- 3) SINCE HOT AIR RISES AND COLD AIR STAYS CLOSE TO LOW POINTS, IN THE COLD MONTHS, YOU SHOULD CLOSE SOME 1ST FLOOR REGISTERS AND MAKE SURE THAT OTHER REGISTERS ARE NOT BLOCKED BY FURNITURE OR OTHER OBJECTS.
- 4) TO ELIMINATE HOT AND COLD SPOTS IN YOUR HOME, TURN THE FAN SWITCH ON THE THERMOSTAT TO THE ON POSITION.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SYSTEM SO THAT IT WILL MEET THE PERFORMANCE STANDARD.

**THERMOSTAT
DIFFERS FROM
ACTUAL
INSIDE
TEMPERATURE**

CONDITION

THERMOSTAT SETTING DIFFERS FROM ACTUAL INSIDE TEMPERATURE.

PERFORMANCE STANDARD

ON EXTREMELY COLD DAYS, A 5 TO 7 DEGREE DIFFERENCE BETWEEN THE ACTUAL INSIDE TEMPERATURE (MEASURED 5 FEET ABOVE THE CENTER OF THE FLOOR) AND THERMOSTAT SETTING IS ACCEPTABLE AND SHOULD BE EXPECTED. ALL ROOMS WILL ALSO VARY IN TEMPERATURES AS MUCH AS 3 TO 5 DEGREES. THIS IS ALSO ACCEPTABLE. DURING NORMAL WEATHER CONDITIONS, DEGREE VARIATIONS OF 6 DEGREES OR MORE WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IT IS THE RESPONSIBILITY OF THE HOMEOWNER TO BALANCE THE COOLING/HEATING SYSTEM BY ADJUSTING THE DAMPERS AND REGISTERS AS NEEDED.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SYSTEM TO MEET THE PERFORMANCE STANDARD.

**NOISY DUCT-
WORK OR OIL
CANNING**

CONDITION

NOISY DUCTWORK OR OIL CANNING.

PERFORMANCE STANDARD

WHEN METAL IS HEATED IT WILL EXPAND, AND WHEN IT IS COOLED IT WILL CONTRACT. AS A RESULT OF THIS EXPANSION AND CONTRACTION, THE DUCTWORK WILL "CRACKLE" OR "TICK". THIS NOISE IS NORMAL AND SHOULD BE EXPECTED. VERY LOUD (BOOMING) NOISES CAUSED BY OIL CANNING (STIFFENING OF DUCTWORK) WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE DUCTWORK TO ELIMINATE THIS NOISE.

ELECTRICAL

**BLOWN FUSES
OR CIRCUIT
BREAKERS
“KICK-OUT”
OFTEN**

CONDITION

BLOWN FUSES OR CIRCUIT BREAKS (NOT INCLUDING GROUND FAULT INTERRUPTERS) “KICK OUT” CONSISTENTLY.

PERFORMANCE STANDARD

FUSES AND CIRCUIT BREAKS SHOULD NOT BE ACTIVATED UNDER NORMAL USAGE.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: NONE

BUILDER’S RESPONSIBILITY: THE BUILDER WILL INSPECT AND CORRECT THE CIRCUIT WIRING WHICH DOES NOT CONFORM TO THE LOCAL ELECTRICAL CODES.

**GFI (GROUND
FAULT
INTERUPTER
TRIPS FRE-
QUENTLY**

CONDITION

GROUND FAULT INTERRUPTER (GFI) TRIPS FREQUENTLY.

PERFORMANCE STANDARD

GFIS ARE SENSITIVE SAFETY DEVICES THAT ARE INSTALLED INTO THE ELECTRICAL SYSTEM TO PROVIDE PROTECTION AGAINST ELECTRICAL SHOCK. THESE DEVICES ARE SENSITIVE AND CAN BE TRIPPED VERY EASILY. HUMIDITY, ELECTRICAL SURGES, FAULTS IN LINES AND WATER SPLASHED INTO AN OUTLET CAN CAUSE A GFI TO TRIP.

RESPONSIBILITY

HOME OWNER’S RESPONSIBILITY: IF YOUR GFI SHOULD TRIP, IT IS ONLY NECESSARY FOR YOU TO PUSH IN THE RESET BUTTON ON THE GFI OUTLET. GFIS SHOULD BE TESTED MONTHLY. REFER TO YOUR CARE AND USE INFORMATION FOR FURTHER DETAILS.

BUILDER’S RESPONSIBILITY: GFIS ARE INSTALLED FOR YOUR PROTECTION. GFIS WILL FREQUENTLY TRIP IF WATER SPLASHES IN THE PROTECTED RECEPTACLE. THIS IS FOR YOUR PROTECTION AND IS NOT A DEFECT. THE BUILDER WILL REPAIR GFIS THAT ARE INOPERABLE DUE TO A CONSTRUCTION DEFECT.

PLUMBING

PIPES FREEZING

CONDITION

PIPES FREEZING.

PERFORMANCE STANDARD

PLUMBING PIPES WILL BE ADEQUATELY PROTECTED TO PREVENT FREEZING.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IF ANY PIPES SHOULD FREEZE, DO NOT TURN THE WATER SUPPLY OFF UNLESS THE PIPE HAS BURST, THEN NOTIFY THE BUILDER OR PLUMBER IMMEDIATELY.

NOTE: HOMEOWNERS ARE RESPONSIBLE FOR DRAINING PIPE LINES FOR EXTERIOR FAUCETS. BE SURE TO SHUT OFF ALL EXTERIOR FAUCETS PRIOR TO FREEZING TEMPERATURES. TO SHUT OFF YOUR EXTERIOR FAUCETS, THERE IS A SEPARATE SHUT-OFF VALVE ON THE INSIDE OF THE HOUSE FOR EACH FAUCET. TURN THIS VALVE OFF AND GO OUTSIDE AND OPEN THE EXTERIOR FAUCET. GO BACK INSIDE AND OPEN THE LITTLE DRAIN CAP VALVE ON THE SIDE OR BOTTOM OF THE INSIDE VALVE TO DRAIN IT. LEAVE THIS FAUCET OPEN UNTIL SPRING. FAILURE TO DO THIS MAY CAUSE YOUR PIPES TO BURST AND THIS IS NOT COVERED UNDER THE WARRANTY.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE SITUATION TO PREVENT PIPES FROM REFREEZING. THE CORRECTION MAY INVOLVE OPENING THE WALLS FOR ACCESS TO THE PIPE, AND EITHER ADDING OR REPLACING INSULATION WHICH MAY HAVE MOVED DURING THE CONSTRUCTION PROCESS OR LEAVING A PERMANENT VENT INTO THE WARMER SPACE TO PREVENT THE FREEZE FROM RECURRING.

FAUCET OR VALVE LEAKAGE

CONDITION

FAUCET OR VALVE LEAK.

PERFORMANCE STANDARD

NO VALVE OR FAUCET SHOULD LEAK BECAUSE OF DEFECTS IN THE MATERIAL OR WORKMANSHIP.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: IF LEAKAGE IS DUE TO A DEFECTIVE WASHER IN THE FAUCET, WASHER REPLACEMENT IS A HOME OWNER'S RESPONSIBILITY.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR OR REPLACE THE LEAKING FAUCET OR VALVE UNLESS LEAKAGE IS DUE TO A DEFECTIVE WASHER WHICH IS A HOME OWNER'S RESPONSIBILITY.

NOISY WATER PIPES

CONDITION

NOISY WATER PIPES.

PERFORMANCE STANDARD

EXPANSION AND CONTRACTION OF WATER PIPES CAUSED BY WATER FLOW WILL CAUSE SOME NOISE AND SHOULD BE EXPECTED. HOWEVER, WATER HAMMERING NOISES IN PIPES WILL BE CORRECTED.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REMOVE NOISES NOT DUE TO THE FLOW OF WATER.

PIPES LEAK

CONDITION

PIPES LEAK.

PERFORMANCE STANDARD

NO LEAKS OF ANY KIND SHOULD EXIST IN ANY SOIL, WASTE, VENT OR WATER PIPE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: MOST PLUMBING SYSTEMS INCLUDE A SERIES OF EMERGENCY SHUT-OFF VALVES THROUGHOUT THE HOME. MAKE SURE YOUR FAMILY KNOWS WHERE THE LOCATION OF THE SHUT-OFF VALVES ARE FOR EMERGENCY PURPOSES. YOU WILL MOST LIKELY FIND SHUT-OFF VALVES FOR THE KITCHEN UNDER THE SINK. IN THE BATHROOM, VALVES ARE USUALLY PROVIDED FOR THE SINK, TOILET AND BATHTUB. YOU CAN USUALLY FIND THE SINK SHUT-OFF VALVES BELOW THE FIXTURES. THE TOILET HAS A SINGLE COLD WATER VALVE NORMALLY INSTALLED BELOW THE WATER TANK. TUB VALVES ARE ACCESSED THROUGH THE ACCESS PANEL IN BACK OF THE FAUCET CONTROLS.

ALSO NOTE THE LOCATION OF YOUR MAIN SHUT-OFF SINCE THIS WILL STOP ALL WATER THROUGHOUT THE HOUSE IN SECONDS.

IN THE EVENT OF ANY LEAKING PIPE, MAKE SURE TO TURN THE WATER OFF BY THE USE OF THE SHUT-OFF VALVE. THIS WILL PREVENT ANY FURTHER DAMAGE FROM OCCURRING.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL MAKE NECESSARY REPAIRS TO ELIMINATE LEAKAGE.

CONDENSATION APPEARS ON PIPES

CONDITION

CONDENSATION APPEARS ON PIPES.

PERFORMANCE STANDARD

CONDENSATION ON PIPES MAY RESULT BECAUSE OF CERTAIN COMBINATIONS OF TEMPERATURE AND INDOOR HUMIDITY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: NONE

PLUMBING FIXTURES, APPLIANCES, ETC. LEAK OR MALFUNCTION

CONDITION

PLUMBING FIXTURES, APPLIANCES OR TRIM FITTINGS LEAK OR MALFUNCTION.

PERFORMANCE STANDARD

FIXTURES, APPLIANCES OR FITTINGS WILL COMPLY WITH THE MANUFACTURER'S STANDARD.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPLACE ANY FIXTURE OR FITTING THAT IS OUTSIDE "PERFORMANCE STANDARDS," AS DEFINED BY THE MANUFACTURER.

**CRACKS OR
CHIPS IN
PORCELAIN OR
FIBERGLASS
SURFACES**

CONDITION

CRACKS OR CHIPS IN PORCELAIN OR FIBERGLASS SURFACES.

PERFORMANCE STANDARD

CHIPS OR CRACKS CAN OCCUR IF THE SURFACE OF THE FIXTURE IS HIT WITH A SHARP OR HEAVY OBJECT. CRACKS, CHIPS, OR SCRATCHES NOT REPORTED TO THE BUILDER BEFORE OCCUPANCY BY THE HOMEOWNER WILL NOT BE COVERED UNDER THIS WARRANTY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THE HOMEOWNER IS RESPONSIBLE FOR CRACKED, SCRATCHED OR CHIPPED FIXTURES THAT WERE NOT NOTED ON THE ORIGINAL WALK-THRU FORM.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR ONLY THE CHIPS, CRACKS, OR SCRATCHES THAT WERE NOTED ON THE ORIGINAL ACCEPTANCE OF CONSTRUCTION FORM.

**CLOGGED
SEWERS,
FIXTURES OR
DRAINS**

CONDITION

CLOGGED SEWERS, FIXTURES OR DRAINS.

PERFORMANCE STANDARD

SEWERS, FIXTURES AND DRAINS SHOULD OPERATE PROPERLY TO ACCOMPLISH THEIR INTENDED FUNCTION.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: BECAUSE SEWERS, FIXTURES AND DRAINS CAN EASILY BE CLOGGED THROUGH THE HOME OWNER'S NEGLIGENCE, THE HOMEOWNER WILL MAKE THE NECESSARY REPAIRS. IF THE PROBLEM CAN BE ATTRIBUTED TO THE BUILDER'S NEGLIGENCE, THE BUILDER WILL REIMBURSE THE HOMEOWNER FOR THE COST OF THE REPAIR.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REIMBURSE THE HOMEOWNER FOR THE COST OF THE REPAIR, IF THE PROBLEM CAN BE ATTRIBUTED TO THE BUILDER'S NEGLIGENCE.

**ODOR ESCAPES
FROM WATER
DRAINS**

CONDITION

ODORS ESCAPING FROM WATER DRAIN.

PERFORMANCE STANDARD

NONE. SINCE SOME DRAINS ARE USED VERY SELDOM, THE TRAPS MAY DRY OUT AND PERMIT ODORS TO ESCAPE FROM THE SEWER.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO ELIMINATE DRAIN ODORS, ONE QUART OF WATER SHOULD BE Poured DOWN THE DRAIN MONTHLY. THIS MAY ALSO INCLUDE ANY FLOOR DRAINS.

BUILDER'S RESPONSIBILITY: NONE

**FIXTURES DO
NOT HOLD
WATER**

CONDITION

FIXTURES DO NOT HOLD WATER.

PERFORMANCE STANDARD

STOPPERS ON FIXTURES SHOULD RETAIN WATER FOR A SUFFICIENT LENGTH OF TIME TO ACCOMPLISH ITS INTENDED USE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: NONE

BUILDER'S RESPONSIBILITY: THE BUILDER WILL CORRECT THE FIXTURE TO MEET THE PERFORMANCE STANDARD.

**TOILET DOES
NOT FLUSH
COMPLETELY**

CONDITION

TOILET DOES NOT FLUSH COMPLETELY.

PERFORMANCE STANDARD

TOILET FIXTURE SHOULD ACCOMPLISH ITS INTENDED USE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: DUE TO THE STATE MANDATED 1.5 TO 1.6 GALLON CAPACITY FOR FLUSHING VOLUMES, THE TOILET HANDLE WILL NEED TO BE DEPRESSED FOR A LONGER PERIOD OF TIME TO ALLOW MORE WATER TO FLUSH THROUGH THE SYSTEM, TO PREVENT CLOGGING IN THE DRAIN.

BUILDER'S RESPONSIBILITY: IF THE PROBLEM STILL CONTINUES AFTER TRYING THE ABOVE STEPS, THE BUILDER WILL CORRECT THE FIXTURE TO MEET THE PERFORMANCE STANDARD.

**TOILET
CONTINUALLY
RUNS**

CONDITION

TOILET CONTINUALLY RUNS.

PERFORMANCE STANDARD

TOILET FIXTURE SHOULD ACCOMPLISH ITS INTENDED USE.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: TO STOP THE TOILET FROM CONTINUALLY RUNNING, TRY JIGGLING THE TOILET HANDLE. IF THAT DOES NOT WORK, THEN REMOVE THE TANK COVER TO CHECK THE TOILET CHAIN. MAKE SURE THAT THE CHAIN IS NOT CAUGHT ON ANYTHING. ALSO CHECK THE DRAIN VALVE COVER OF THE TOILET TO MAKE SURE IT IS SECURELY SEATED OVER THE DRAIN HOLE OF THE TANK.

BUILDER'S RESPONSIBILITY: IF THE PROBLEM STILL CONTINUES AFTER TRYING THE ABOVE STEPS, THE BUILDER WILL CORRECT THE FIXTURE TO MEET THE PERFORMANCE STANDARD.

ASPHALT DRIVEWAY

SETTLING OR
CRACKING OF
ASPHALT
DRIVEWAY

CONDITION

SETTLING OR CRACKING OF ASPHALT DRIVEWAYS.

PERFORMANCE STANDARD

DRIVEWAYS WILL MOVE UP AND DOWN AS A DIRECT RESULT OF FROST IN THE GROUND. SETTLING THAT IS MORE THAN 1 1/2" MEASUREMENT WITHIN ANY 32" AREA WILL BE REPAIRED ONE TIME ONLY.

RESPONSIBILITY

HOME OWNER'S RESPONSIBILITY: THERE ARE A NUMBER OF PRECAUTIONS A HOMEOWNER SHOULD TAKE SO THE DRIVEWAY REMAINS IN GOOD CONDITION:

- 1.) DO NOT DRIVE ON THE ASPHALT DRIVEWAY FOR THE FIRST THREE DAYS AFTER INSTALLATION.
- 2.) DO NOT PARK ON THE DRIVEWAY FOR AT LEAST 7-14 DAYS AFTER INSTALLATION.
- 3.) ALLOW NO HEAVY VEHICLES (I.E. MOVING VANS, FUEL OIL TRUCKS, ETC.) ON THE DRIVEWAY DURING WARM WEATHER.
- 4.) SPILLAGE OR LEAKAGE OF GAS OR OIL SHOULD BE WASHED OFF IMMEDIATELY.
- 5.) AVOID DRIVING OVER THE EDGES OF THE DRIVEWAY TO PREVENT ANY BREAKAGE OF THE ASPHALT.
- 6.) DURING WARM WEATHER, AVOID PUTTING CHAIRS, LADDERS, BICYCLE KICK STANDS OR ANY SHARP OBJECTS THAT MAY DENT THE DRIVEWAY.
- 7.) TO MAINTAIN THE SURFACE OF YOUR DRIVEWAY, SEALCOATING IS RECOMMEND.

BUILDER'S RESPONSIBILITY: THE BUILDER WILL REPAIR THE SETTLED AREA BY FILLING OR PATCHING THE AFFECTED AREA ONLY. COLOR AND TEXTURE VARIATIONS ARE TO BE EXPECTED AND THE BUILDER WILL NOT BE RESPONSIBLE FOR THESE VARIATIONS.